JOINT INVESTIGATION REPORT FOR IN	CIDENT NO: 992	27-8 JIV report S/N: 0118
(Note: As practicable as possible the JIT	report is to be signed in th	e field by all the participating parties)
A. GENERAL INFORMATION:		
1. Spill incident Number: 9922	2.Typ	e of incident* OIL SPILL
3. Name of Location 36" TRA	NS NIGER	PIRELINE, RUMUERPE-NEPOKU
4. Name of nearest community A	. UU _5. State: <u>R</u>	<u>VERS</u> 6. LGA <u>OB/O/AKPOR</u>
7. Type of Production facility/Installation	OIL PIPELINE 8.	Asset owner/District PIPELINE
B. INCIDENT INFORMATION:		
9. Details of incident  a. Date of incident: 16th Juni  b. Start date/time of investigation:  c. Investigation End date: 20th  d. Description of spill point environ	187 JUNE 201 [UNE 2013 Actual inv	vestigation duration, days: THREE (3)
Firmed soil	Loose soil	Recently excavated area
Under water	☐ Swampy	Exposed pipe surface
Well Platform (on Water)	annliachle):	□Drill Rig
<ul> <li>e. Description of leak point (tick as</li> <li>Drilled hole</li> </ul>	Hack saw cut	☐ Tear (),
Complete Rupture	☐Inward dent,	☐ Well head tampering
Failed Weld-on illegal hot tap va		☐ Missing Pipeline/Flowline
Crude oil theft (illegal bunker		☐ Third party tampering with Clamp
Third party tampering with va		☐ Third party tampering with flange,
Corrosion		, DSurge vessel overflow,
☐Bulging Outward	-	wall failure Accidental 3rd party equipment
impact	·	orn unit failure
Relief valve failure	Others (specify)	
<u> </u>	e□; crude theft□; Line the (including Mystery spills)	heft□; Accidental 3 <sup>rd</sup> party damage□)
g. Spill point coordinates  Measuring unit	MWATA	MID BELT
Northing:	. (1000	Easting: Cm
104678.	26	497342:00

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 992278 JIV report S/N: 0118

C.	RISK ASSESS	SMENT						
	10.	Γype of environment:			1			
	<b>□</b> Land	Swamp	□Water	□Sea	sonal swam	p□Sho	oreline/Wa	terfront
	i. T	ype of environment to	which oil has	spread:				
	Land	□Swamp	Water	□Riv	er (identify)	l		
	ii. W	eather condition						
	Rain 11. Distance fr	Sunny som the nearest sensitive	□Dry /e habitat	<b>√</b> Wet	□Windy		□Hot	Cool
	□ Drinki □ Built t □ Farml: □ Fish F □ Fishin	ands arm/Pond	signated prot	ected area	[ [ <b>&lt;</b> 50, [	m] m] m] m] m]		
	□Booms	ent measures put in places:  Trench	ce; □Dyke	<b>√</b> Nat	tural depress	ion	□Pit	
	13. Any pictur	es or video coverage?			UN I	[ N ]		
	14. Was there	any disruption to the in	nvestigation?		[Y]	M		
If	yes give brief des	scription:						
	NC	)T +	\P	PLI	CA	B	LE	•
D.	TYPE/NUMBE	ERS OF PROPERTIE	S, IF ANY,	FOUND WIT	HIN THE	AREA (	OF SPRE	AD OF OIL

### D.

15. Structures / Properties

S/N	Type of	Structures	Description	Size	Number	Comments
سخا					•	
$\Delta I$	$\Delta M$	14117	7111 1	107	MAC	IMPART
VM	()/V	/ <i>\/                                 </i>	π//V <b>†</b>	TKI	H Ut	MITTUI
$\perp$	<u> </u>		_			,
			_			
					<u> </u>	

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 992278 JIV report S/N: 0118

1	6. Crops/Econo	mic Trees		<u>.                                      </u>		
S/N	Type of crops	Young	Medium	Matured	Quantity	Comments
$\overline{\Lambda}$	ION Y	WITHN	ARE	A OF	= /MF	ACT
					i	


#### 17. Fish/Nets/Ponds

S/N	Fish/Nets/Ponds	Description	Quantity/Size	Comments
lack	ION W	MUN AR	AA	OF IMPACT

18. Others (Specify) i.e. Animal Traps

S/N	Others	Description	Quantity/Size	Comments
1	JON M	MIN ARE	AC	FIMPACT

E. GRAPHIC DESCRIPTION OF LEAK POINT (while detail report of the leak point should be contained in the leak report, overview sketch of the site should be added as an appendix 1)

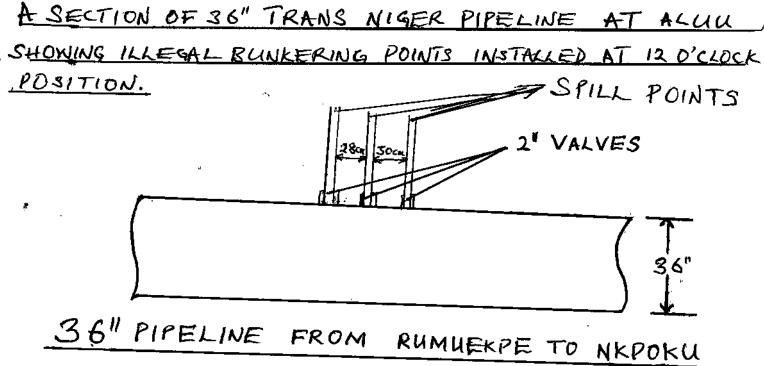

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 992278 JIV report S/N: 0118

F: TABLE SHOWING SOME OF COORDINATES TAKEN DURING JIV FOR AREA CALCULATION 19. Impacted area boundary Coordinates (If more, Print and attach as an appendix)

	MUNDORN BELT
S/N Northing (m)	Easting (m)
210 104675.19	497338.91
211 104672-10	497345 . 07
212 104665.95	497351 - 22-
213 104669.01	497354.31
214 104672:09	47351 . 23
265 604672.08	497354.31
246 104669-50	497357.89
217 104672.06	497363 - 55
268 104668.97	497372.79
29 64675.10	497375 · 39
220 (04618-20	497363 - 57
220 104681.31	497348 17
222 104684.40	497342.02
223 104678:26	497338.92

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 992278 JIV report S/N: 0118

G.	INCIE	ENT	INF	ORM	ATI	ON:
----	-------	-----	-----	-----	-----	-----

20.	Impacted	Area Details
	• T	otal calculated area of impact 0.03449
	• In	mpact within SPDC R.O.W
		mpact outside SPDC R.O.W
21.	Volume o	of oil recovered before completion of JIV (V <sub>recJ</sub> ):
		Recovered oil V <sub>recJ</sub> : Barrels
22.	_	tion of estimated residual volume on site
a.		ion of estimated volume of pool of free phase oil (on land or confined water body).  i. Area (m²) occupied by pool of free phase oil
	ii	NIIIIIIIIIIIIIIIIIIIIIIIIIIIIIIIIIIII
	iii iv	
		Estimated Volume of pool of free phase oil. V <sub>pool</sub> : barrels
b.		ion of estimated volume of infiltrated oil in the soil $(V_{inf})$ .
	1. Es	timated Volume of infiltrated oil at spill point (Vinf a)
	i.	Area* (m²) of soil covered by the oil: 4 - 0 m²
	ii.	Average Depth (m) above leaking facility i.e. pipeline/flowline: 1 - 2 m
	iii.	Soil type: $CLAY$ iv. $P_c$ (effective porosity of the soil). $8\%$
	v.	Cause of spill. Third Buty Interference Oil type: BONNY LIGHT
	vii.	Oil Residence time on site, day: 2
	viii.	Average depth of infiltration below leaking facility i.e. pipeline/flowline: 6.0005
	ix.	Estimated depth of infiltration around spill point: 1.2005 m
		Estimated Volume of infiltrated oil at spill point. Vinf.a: 2-42 barrels
	2. Es	stimated Volume of infiltrated oil at second spill point [if applicable] (Vinf b)
		Area* (m²) of soil covered by the oil;
	ii.	Average Depth (m) above leaking facility i.e. pipeline/flowline:
	iii.	Soil type: iv. $P_e$ (effective porosity of the soil)
	v.	Cause of spill:
	vii.	Oil Residence time on site, day
	viii.	Average depth of infiltration below leaking facility i.e. pipeline/flowline:
	ìx.	Estimated depth of infiltration around spill point:
		Estimated Volume of infiltrated oil at spill point. V <sub>inf_b</sub> : harrels

THE SHELL	. PETROLEUI	M DEVELOPM	ENT COMPA	NY OF N	IGERIA LIN	ITED.
JOINT INVESTIGATION F	EPORT FOR II	NCIDENT NO:_	79227	- <b>8</b> JIV re	port S/N	18
i. A	area (m2) of soil	covered by the oil	296	$M^2$		<u> </u>
		ool of free phase			VIL	
		) below ground so			_	25
iv. S	oil type: _ C人	AY				
v. 1	P (effective noro	sity of the soil)	8 %			
						11.
v	i. Estimat	ed Volume of infi	iiirated oii. At	V inf:	<u>0.08</u>	barrels
	of oil on open wa	- / 1				on. CG FOG (2000
	Thickness	Percentage		·		
Barely Visible	0.00004	coverage	Volume (m3	<u>")</u>		
Silvery	0.00004		7			
Slight Color	0.00015		<del>                                     </del>			
Bright Color	0.0003			╡		
Dull	0.001	D1 10	1 12 1	<del></del>		
Dark	0.002	r_ 10	A15L	<u></u>		
Black oil	1.0	,				
Emulsion (30% Oil)	1					
	Percent Total	100%				
iii.	Estimated Volu	me of oil on open	water. V <sub>wat</sub> :	N/	4	Barrels
24. Calculation of	f evaporated vo	lume:				
i. Estin	nated Volume a	vailable for evap	oration within	surface ar	ea: <u>2 \ 5 C</u>	<u>) bb(</u>
ii. E-Fa	ctor: <u>25 %</u>					
iii.	EstimatedVo	olume of evaporat	ed oil. Vevap:	0.8	3	Barrels
Evan	oration Factors	(E-Factor) for S	PDC Crude oil	1		
Oil Type	Days on site	Bonny Light	Bonny Me			
Oil Residence time	< 1 day	10%		5%		
	1-7 days	25%	_	15%		

Evap	oration Factors	(E-Factor) for SF	DC Crude oil
Oil Type	Days on site	Bonny Light	Bonny Medium
Oil Residence time	< 1 day	10%	5%
	1-7 days	25%	15%
	> 7 days	40%	25%

25. Net Estimated Spilled Volume $V_{Est}(bbls) = V_{evap}(bbls) + V_{wat}(bbls) + V_{inf}(bbls) + V_{pool}(bbls)$
(bbls) + V <sub>recJ</sub> (bbls) = 0.83 + N/L+ 2.50+ N/L+ N/L = 3.33
3.33 ~ H BARRELS
Estimated Reported Volume** Vreg(bbls)=

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 992278 JIV report S/N: 011
--

Calculation of the respective estimated volume is to be done on site as far as practicable using the new spill volume estimation software on site; Conversion of  $m^3$  to barrels is Volume (m3) x 6.29; \*\*Round up estimated volume to next whole number using the following rules:

	<u> </u>		
•	Any spill volume in excess of	1 bbl	is rounded up to the next whole number.

Any spill volume in less than I bbl is rounded up to the next 0.1 bbl.

Examples: Calculated volume = 15.3 bbl ----- Reported volume = 16 bbl Calculated volume = 0.35 bbl ----- Reported volume = 0.4 bbl Calculated volume = 0.01 bbl ------ Reported volume = 0.1 bbl.

#### 26. GENERAL STATUS OF THE SITE

-	A.	Joint investigation of the incident site found that there is no residual impact after the initial response and therefore recommend that the site be closed out
	В.	Investigation of the incident site showed that there is residual impact on site requiring further works

#### 27. REPRESENTATIVES

This report was filled, agreed and signed on the 20/06/2013 by joint investigation representatives from

- Host Community★
- Department of Petroleum Resources [DPR]: □
- National Oil Spill Detection and Response Agency [NOSDRA]:
- State Ministry of Environment [SME]:
- Nigeria Police Force [NPF]: □
- Shell Petroleum Development Company [SPDC]:
- Signatories agree with reported findings:
- Separate DPR form has been filled out with same findings□

Tick as applicable

<sup>\*\*</sup> Wherever this estimation tool is not applicable please refer to paragraph 6c (Deviations) of the JIV procedure to use appropriate

\*\* steps for column estimation; record the calculation in a plain sheet of paper and attach to the JIV report.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 992278 JIV report S/N: 0118

28. Appendix 1: Overview sketch of the site

