JOINT INVESTIGATION REPORT FOR INCIDENT NO: 950208 JIV report S/N: 0031

(Note: As practicable as possible the JIT report is to be signed in the field by all the participating parties)

A. GENERAL INFORMATION:	
1. Spill incident Number: 950208	2.Type of incident* O/L SPILL
3. Name of Location 24" NKPOKU -BOM	U PIPELINE
4. Name of nearest community BERA 5. Stat	
7. Type of Production facility/Installation OIL PIPELIME	
B. INCIDENT INFORMATION:	
9. Details of incident  a. Date of incident: 27 TH MARCH, 2013  b. Start date/time of investigation: 2 2 TH MARCH, 2014  c. Investigation End date: 28 TH MARCH, 2014	ARCH, 2013 ual investigation duration, days: 1 DAY
d. Description of spill point environment  Firmed soil  Loose soil	☑Recently excavated area
Under water Swampy	Exposed pipe surface
☐Well Platform (on Water)	□Drill Rig
e. Description of leak point (tick as applicable);	
Drilled hole Hack saw cur	-
☐Complete Rupture ☐Inward dent,	
Failed Weld-on illegal hot tap valve, Failed Clamp	and the second s
☐ Crude oil theft (illegal bunkering) point,	Third party tampering with Clamp
☐ Third party tampering with valve settings,	☐ Third party tampering with flange,
☐Corrosion ☐Saver <sup>2</sup> pit ove	<del>-</del>
☐Bulging Outward ☐Flare System	/Bund wall failure Accidental 3rd party equipment
impact	□com unit failure □Cold vent
☐Relief valve failure ☐Others (speci	fy)MISSING CLAMP
f. Incident caused by:	The shaff And Janes 21 mater democratic
☐ Third party interference (Sabotage□; crude theft□;	
Operational Others (including Mystery	spills)
g. Spill point coordinates  Measuring unit	MINNA MID-BELT
Northing:	Easting:
75 881.97.	535040.65
	·

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 950208 JIV report S/N: 0031

C.	RISK ASSESSME	NT						
	10. Type	of environment:						
	Land	□ Swamp	□water	□Sea	sonal swamp□SI	horeline/Wat	erfront	
	i. Type o	f environment to	which oil has	spread:				
	Land	□Swamp	□Water	□Riv	er (identify)			
	ii. Weath	er condition						
	☐Rain 11. Distance from t	Sunny he nearest sensiti	<b>1</b> ☑Dry ve habitat	□Wet	□Windy }	□Hot	□cool	
	Governmer Drinking w Built up are Farmlands Fish Farm/ Fishing net Others (spe	Pond	esignated prote	ected area	[m,] [m,] [m,] [m,]			
	12. Containment me	easures put in pla	ce;					
	□Booms □Others:	Trench	□Dyke	□Na	tural depression	Pit		
	13. Any pictures or	video coverage?		<b>\</b>	[N]			
	14. Was there any d	lisruption to the i	nvestigation?		[Y] (Y)			
[f y	es give brief descript	ion:						
	NOT	APP	107	BLE				
D,	TYPE/NUMBERS (	٠,	es, if any, i	FOUND WIT	THIN THE AREA	OF SPREA	AD OF OIL	
S/N	Type of Structu	ıres Descri	iption Size	" Nu	mber	Comm	ents	٦
								1
	Maria							
		- 1115	14-HN	ARE	A 10F	IMP	AC?	_

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 950208 JIV report S/N:

1	<ol><li>Crops/Economic Trees</li></ol>	3		

S/N	Type of crops	Young	Medium	Matured	Quantity	Comments
	MMALI	- 1117417	1 101	CA MI	10.00	
	IV OIYE	· IN LITT	Y MA	THE UP	11477	<u> </u>

#### 17. Fish/Nets/Ponds


S/N	Fish/Nets/Ponds	Description	Quantity/Size	Comments	
	NAME	WITHIN ADI	A 17E	11000	
	111 O IV I	<u> </u>	TR OI	1111111 C 3	

18. Others (Specify) i.e. Animal Traps

S/N	Others	Description	Quantity/Size	Comments	
			<u> </u>		
	NAME	LALTHUE AD	E-V VI	IMPAG	
	NUNL	Will Luild WK		1111776	
	ļ				

E. GRAPHIC DESCRIPTION OF LEAK POINT (while detail report of the leak point should be contained in the leak report, overview sketch of the site should be added as an appendix 1)

SECTION OF 24" NKPOKU-ROMU PIPELINE AT BERA SHOWING POSITION OF REMOVED CLAMP AND BOLT

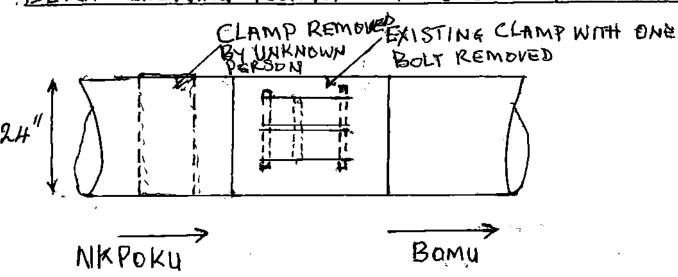

Page 3 of 9

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 950208 JIV report S/N: 0031

F: TABLE SHOWING SOME OF COORDINATES TAKEN DURING JIV FOR AREA CALCULATION
19. Impacted area boundary Coordinates (If more, Print and attach as an appendix)

Northing (M)	(If more, Print and attach as an appendix)  [Easting (1)]
75 895.04	
75 885.03	505037.58 5043.74
75 875.80	53 50 40. 64
75 878.91	53 5034.48
	335034.70
	7
<i>n</i>	
	<del></del>
· · · · · · · · · · · · · · · · · · ·	
	<u> </u>
	-
	· · · · · · · · · · · · · · · · · · ·
	-
	75 885.04 75 885.04 75 875.82 75 878.91

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 950208 JIV report S/N:	AICU.
G. INCIDENT INFORMATION:	0031
20. Impacted Area Details	
_	
• Total calculated area of impact	
• Impact within SPDC R.O.W	
• Impact outside SPDC R.O.W	
21. Volume of oil recovered before completion of JIV (V <sub>recJ</sub> ):	- <b></b> -
Recovered oil V <sub>recJ</sub> :	Barrels
22. Computation of estimated residual volume on site	<del></del>
a. Computation of estimated volume of pool of free above 1	
The phase of	t.
ii. Average Depth (m) of pool of free phase oil	
iii. Emulsification factor:iy.	
Estimated Volume of pool of free phase oil. V <sub>pool</sub> :	barrels
b. Computation of estimated volume of infiltrated all in the	
1. Estimated Volume of infiltrated oil at spill point (Vinf a)	
i. Area* (m²) of soil covered by the oil: 2.25 m²	
ii. Average Depth (m) above leaking facility i.e. pipeline/flowline: 1.2 M	
III. Soil type: ( L. H.Y. i. p. cm.)	
V. Cause of spill: TATERERENE VI. Oil type: BONNY MEDIUM	_
VII. Oil Residence time on site, day: 1 DAY	
viii. Average depth of infiltration below leaking facility i.e. pipeline/flowline: <u>O.001</u>	23M
Estimated depth of infiltration around spill point: 1.2003 M	<del></del>
Estimated Volume of infiltrated oil at spill point. V <sub>inf.a</sub> : 1.26	
	barrels
2. Estimated Volume of infiltrated oil at second spill point [if applicable] (Vinf b)	
i. Area* (m²) of soil covered by the oil: NIL  ii. Average Depth (m) shows location 6 articles at 1	
The Print (III) 400 VC ICAKING FACILITY 1 0 mineline in 11 11	
$P_c$ (effective porosity of the soil) All	
vi. Oil type: NI L	
with the off site, day: MIL	
iv Estimated death of the first state of the first	_
Estimated depth of infiltration around spill point:  Estimated Volume of infiltrated oil at spill point. Vinf.b:   barre	
NIL NIL	İs
3. Estimated Volume of infiltrated oil outside immediate spill point(s) region (Vinf c)	
The state of the s	

NT INVESTIGATION F						
		covered by the oil:				
		ool of free phase oi				
		n) below ground sur	face of infiltrat	ion of oil:	0.0003	<u>m</u>
iv. S	Goil type: <u>C</u>	<u>/A.</u>				
<b>v.</b>	P <sub>e</sub> (effective por	osity of the soil)	<u>8%                                    </u>			
v	ri. Estima	ted Volume of infilt	rated oil. At V	inf:	0-01	barr
23. Computation	of estimated vo	olume of oil on op	en water base	d on stan	dard colorati	on.
	of oil on open wa					
	-	il on water based or	coloration (	 **Spill	Factors from U	SCG FOG (20
			,	Edition)	-	
	Thickness (mm)	Percentage coverage	Volume (m3	1		
Barely Visible	0.00004	LO TO LIE	v viane (ini	Ĺ		
Silvery	0.00008			7		
Slight Color	0.00015	nlas				
Bright Color	0.0003					
Dull	0.001	- , 0 ,				
Dark	0.002	ADDI		_		
Black oil	0.1	AYYLI	JHBLE			
Emulsion (30% Oil)	1					
	Percent Total	1 <b>00</b> %		_		
iii.	Estimated Volu	me of oil on open w	ater. V <sub>wat</sub> :	NIL	<b>.</b>	Barrels
24. Calculation of	of evaporated vo	olume:				
	nated Volume a	vailable for evapo	ration within	surface a	urea: 1.3-	7 Barrei
11. L-1 a		<u>U</u>				
iii.	EstimatedV	olume of evaporated	l oil. V <sub>evap</sub> :	0.2	H	Barrels
Evap	oration Factors	(E-Factor) for SP	DC Crude oil			
Oil Type	Days on site	Bonny Light	Bonny Me			
Oil Residence time	< 1 day	10%		5%		
	1-7 days	25%		15%		
	> 7 days	40%		25%		
		$lume V_{Est}(bbls) =$				
		lume V <sub>Est</sub> (bbls) = f + NIL + 1				

INT INVE	STIGATION REPORT FOR INCIDENT NO: $950208$ JIV report S/N: $031$
software	tion of the respective estimated volume is to be done on site as far as practicable using the new spill volume estimation on site; Conversion of m³ to barrels is Volume (m3) x 6.29; **Round up estimated volume to next whole number using wing rules:
•	Any spill volume in excess of 1 bbl is rounded up to the next whole number.
•	Any spill volume in less than 1 bbl is rounded up to the next 0.1 bbl.
	Examples: Calculated volume = 15.3 bbl Reported volume = 16 bbl Calculated volume = 0.35 bbl Reported volume = 0.4 bbl Calculated volume = 0.01 bbl Reported volume = 0.1 bbl.
Whereve steps for	er this estimation tool is not applicable please refer to paragraph 6c (Deviations) of the JIV procedure to use appropria column estimation; record the calculation in a plain sheet of paper and attach to the JIV report.
26.	GENERAL STATUS OF THE SITE
Α.	Joint investigation of the incident site found that there is no residual impact after the initial
	response and therefore recommend that the site be closed out
27.	REPRESENTATIVES report was filled, agreed and signed on the 22/03/20/3 by joint investigation
represe	Host Community:
•	Department of Petroleum Resources [DPR]: □
•	National Oil Spill Detection and Response Agency [NOSDRA]:
•	State Ministry of Environment [SME]: 2
•	Nigeria Police Force [NPF]: Va
•	Shell Petroleum Development Company [SPDC].
•	Signatories agree with reported findings:
•	Separate DPR form has been filled out with same findings□
	Tick as applicable

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 950208 JIV report S/N: 0031

28. Appendix 1: Overview sketch of the site

