

**THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.**

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1066301 JIV report S/N: 0332

(Note: As practicable as possible the JIT report is to be signed in the field by all the participating parties)

**A. GENERAL INFORMATION:**

1. Spill incident Number: 1066301 2. Type of incident\* OIL SPILL AND FIRE  
 3. Name of Location 24" Nkpoku - BOMU PIPELINE  
 4. Name of nearest community KPIE 5. State: RIVERS 6. LGA TAI  
 7. Type of Production facility/Installation OIL PIPELINE 8. Asset owner/District PIPELINE

**B. INCIDENT INFORMATION:**

9. Details of incident

- a. Date of incident: 3<sup>RD</sup> NOVEMBER, 2013  
 b. Start date/time of investigation: 07<sup>TH</sup> NOVEMBER, 2012 / 12:20PM  
 c. Investigation End date: 07<sup>TH</sup> NOVEMBER, 2013 actual investigation duration, days: ONE DAY  
 d. Description of spill point environment

- |   |  |   |
|---|--|---|
| <input type="checkbox"/> Firmed soil              | <input checked="" type="checkbox"/> Loose soil | <input checked="" type="checkbox"/> Recently excavated area |
| <input type="checkbox"/> Under water              | <input type="checkbox"/> Swampy                | <input type="checkbox"/> Exposed pipe surface               |
| <input type="checkbox"/> Well Platform (on Water) |  | <input type="checkbox"/> Drill Rig                          |
- e. Description of leak point (tick as applicable);
- |   |   |   |
|---|---|---|
| <input type="checkbox"/> Drilled hole                               | <input checked="" type="checkbox"/> Hack saw cut        | <input type="checkbox"/> Tear (_____).                      |
| <input type="checkbox"/> Complete Rupture                           | <input type="checkbox"/> Inward dent,                   | <input type="checkbox"/> Well head tampering                |
| <input type="checkbox"/> Failed Weld-on illegal hot tap valve,      | <input type="checkbox"/> Failed Clamp                   | <input type="checkbox"/> Missing Pipeline/Flowline          |
| <input type="checkbox"/> Crude oil theft (illegal bunkering) point, |   | <input type="checkbox"/> Third party tampering with Clamp   |
| <input type="checkbox"/> Third party tampering with valve setting,  |   | <input type="checkbox"/> Third party tampering with flange, |
| <input type="checkbox"/> Corrosion                                  | <input type="checkbox"/> Saver-pit over flow,           | <input type="checkbox"/> Surge vessel overflow,             |
| <input type="checkbox"/> Bulging Outward                            | <input type="checkbox"/> Flare System/Bund wall failure | <input type="checkbox"/> Accidental 3 <sup>rd</sup> party   |
| equipment impact  | <input type="checkbox"/> Valve Failure                  | <input type="checkbox"/> com unit failure                   |
| <input type="checkbox"/> Cold vent                                  |   |   |
| <input type="checkbox"/> Relief valve failure                       | <input type="checkbox"/> Others (specify) _____         |   |

f. Incident caused by:

- Third party interference (Sabotage ; crude theft ; Line theft ; Accidental 3<sup>rd</sup> party damage   
 Operational  Others (including Mystery spills) \_\_\_\_\_

g. Spill point coordinates

Measuring unit (m)		MINNA MID-BELT	
Northing:		Easting:	
	78931.37		535352.31
	78919.64		535350.91
	78903.93		535347.97

PULL FIRE POINT 1  
 PULL FIRE POINT 2  
 PULL FIRE POINT 3

\*This can be: a) Oil Spill b) Drilling fluid/Chemical c) Siltation d) construction e) Encroachment f) Fire,

**THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.**

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1066301 JIV report S/N: 0332

**C. RISK ASSESSMENT**

10. Type of environment:

- Land       Swamp       Water       Seasonal swamp  Shoreline/Waterfront

i. Type of environment to which oil has spread:

- Land       Swamp       Water       River (identify) \_\_\_\_\_

ii. Weather condition

- Rain       Sunny       Dry       Wet       Windy       Hot       Cool

11. Distance from the nearest sensitive habitat

- Government reserved and designated protected area [            ,m]
  - Drinking water source [            ,m]
  - Built up area [            ,m]
  - Farmlands [            ,m]
  - Fish Farm/Pond [            ,m]
  - Fishing net [            ,m]
  - Others (specify). [            ,m]
- None seen within vicinity*

12. Containment measures put in place;

- Booms       Trench       Dyke       Natural depression       Pit
- Others: EXCAVATED PIT AT LEAK POINT

13. Any pictures or video coverage?       [ N ]

14. Was there any disruption to the investigation?      [ Y ]

If yes give brief description:

NOT APPLICABLE

**D. TYPE/NUMBERS OF PROPERTIES, IF ANY, FOUND WITHIN THE AREA OF SPREAD OF OIL**

15. Structures / Properties

S/N	Type of Structures	Description	Size	Number	Comments
		<u>NONE WITHIN AREA OF IMPACT</u>			

16. Crops/Economic Trees

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1066301 JIV report S/N: 0332

S/N	Type of crops	Young	Medium	Matured	Quantity	Comments
	NONE WITHIN AREA OF IMPACT					

17. Fish/Nets/Ponds


S/N	Fish/Nets/Ponds	Description	Quantity/Size	Comments
	NONE WITHIN AREA OF IMPACT			

18. Others (Specify) i.e. Animal Traps

S/N	Others	Description	Quantity/Size	Comments
	NONE WITHIN AREA OF IMPACT			

E. GRAPHIC DESCRIPTION OF LEAK POINT (while detail report of the leak point should be contained in the leak report, overview sketch of the site should be added as an appendix 1)

SECTION OF 24" Nkpoku - BOMU PIPELINE AT KPITE SHOWING POSITION OF HACK SAW CUT 3 POINTS AT 3 O'CLOCK POSITION.

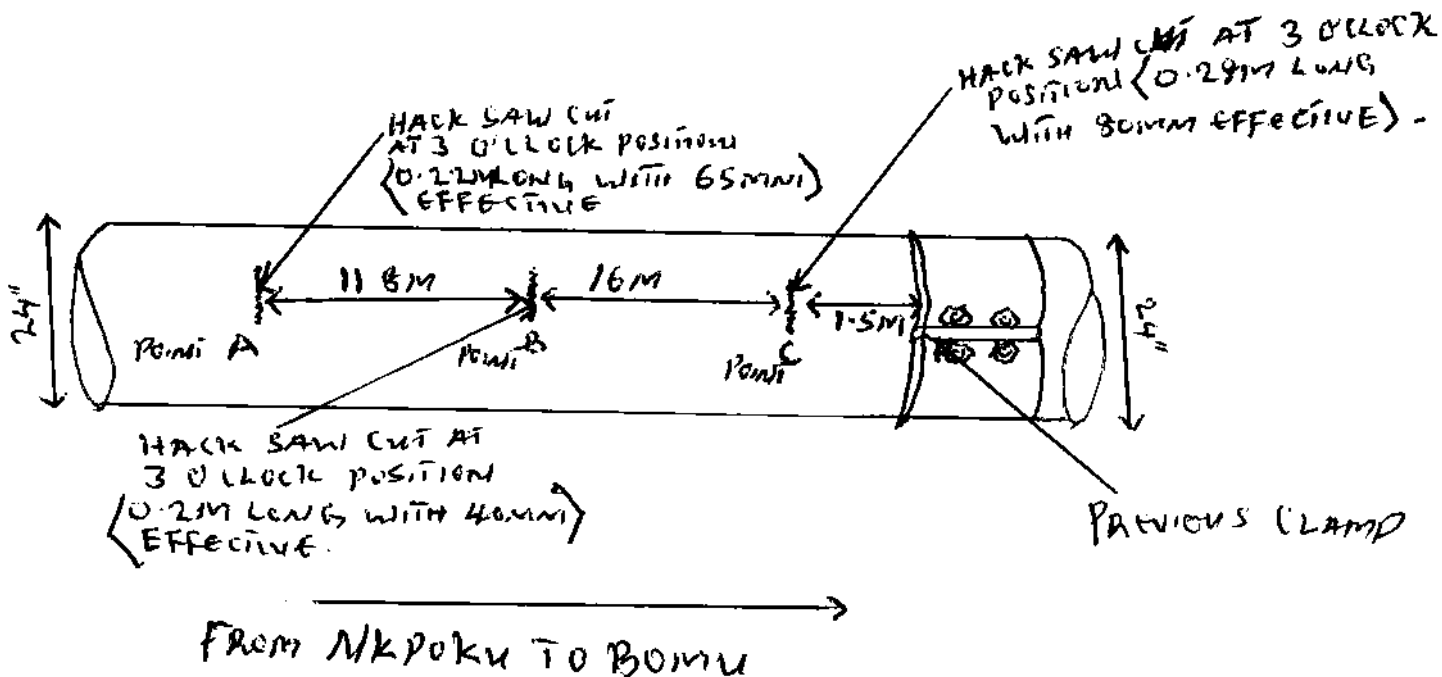

F: TABLE SHOWING SOME OF COORDINATES TAKEN DURING JIV FOR AREA CALCULATION

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1066301 JIV report S/N: 0332

19. Impacted area boundary Coordinates (If more, Print and attach as an appendix)

MINNA MID-BELT

S/N	Northing (M)	Easting (M)
WP704	78 903.93	535 347.97
WP705	78 928.51	535 341.85
WP706	78 932.87	535 355.92
WP707	78 916.20	535 354.16
WP708	78 894.70	535 354.12
WP709	78 879.36	535 347.93
WP710	78 888.57	535 347.95
WP711	78 891.66	535 338.71
WP712	78 897.80	535 341.80
WP713	78 897.80	535 338.72
WP714	78 910.08	535 341.82

G. INCIDENT INFORMATION:

20. Impacted Area Details

- Total calculated area of impact 0.06 Ha.
- Impact within SPDC R.O.W YES
- Impact outside SPDC R.O.W YES

21. Volume of oil recovered before completion of JIV ( $V_{rec}$ ):

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1066301 JIV report S/N: 0332

Recovered oil $V_{rec}$ :	<u>NIL</u>	Barrels
---------------------------	------------	---------

22. Computation of estimated residual volume on site

a. Computation of estimated volume of pool of free phase oil (on land or confined water body).

- i. Area ( $m^2$ ) occupied by pool of free phase oil 1.44
- ii. Average Depth (m) of pool of free phase oil 0.09
- iii. Emulsification factor: —

Estimated Volume of pool of free phase oil.	<u>0.92</u>	barrels
$V_{pool}$ :		

THIRD SPILL POINT  
 AREA = 1.20M<sup>2</sup>

b. Computation of estimated volume of infiltrated oil in the soil ( $V_{inf}$ ).

LEAKING FACILITY = 1.5

- i. Area\* ( $m^2$ ) of soil covered by the oil: 0.72
- ii. Average Depth (m) above leaking facility i.e. pipeline/flowline: 1.8
- iii. Soil type: CLAY iv.  $P_c$  (effective porosity of the soil): 8%
- v. Cause of spill: INTERFERENCE vi. Oil type: BONNY MEDIUM
- vii. Oil Residence time on site, day: 4 DAYS

OIL TYPE = CLAY

EFFECTIVE POROSITY OF THE SOIL = 8%

CAUSE OF SPILL = INTERFERENCE

OIL TYPE: BONNY MEDIUM

RESIDENCE TIME ON SITE, DAY = 4 DAYS

- viii. Average depth of infiltration below leaking facility i.e. pipeline/flowline: 0.0011M
- ix. Estimated depth of infiltration around spill point: 1.8011M

AVERAGE DEPTH OF INFILTRATION BELOW LEAKING FACILITY = 0.0011M

ESTIMATED DEPTH OF INFILTRATION AROUND SPILL POINT = 1.5011M

Estimated Volume of infiltrated oil at spill point. $V_{inf,a}$ :	<u>0.65</u>	barrels
---	-------------	---------

Estimated Volume of infiltrated oil at second spill point [if applicable] ( $V_{inf,b}$ )

- i. Area\* ( $m^2$ ) of soil covered by the oil: 1.2
- ii. Average Depth (m) above leaking facility i.e. pipeline/flowline: 1.8
- iii. Soil type: CLAY iv.  $P_c$  (effective porosity of the soil): 8%
- v. Cause of spill: INTERFERENCE vi. Oil type: BONNY MEDIUM
- vii. Oil Residence time on site, day: 4 DAYS

ESTIMATED DEPTH OF INFILTRATION AROUND SPILL POINT = 1.5011M

ESTIMATED VOLUME OF INFILTRATED OIL AT SPILL POINT = 0.91 BARRELS

- viii. Average depth of infiltration below leaking facility i.e. pipeline/flowline: 0.0011M
- ix. Estimated depth of infiltration around spill point: 1.8011M

Estimated Volume of infiltrated oil at spill point. $V_{inf,b}$ :	<u>1.09</u>	barrels
---	-------------	---------

3. E

Estimated Volume of infiltrated oil outside immediate spill point(s) region ( $V_{inf,c}$ )

- i. Area ( $m^2$ ) of soil covered by the oil: 596.88
- ii. Area ( $m^2$ ) of the pool of free phase oil in touch with soil: 1.44
- iii. Average Depth (m) below ground surface of infiltration of oil: 0.011
- iv. Soil type: CLAY
- v.  $P_c$  (effective porosity of the soil): 8%

Estimated Volume of infiltrated oil. At $V_{inf,c}$ :	<u>0.33</u>	barrels
---	-------------	---------

23. Computation of estimated volume of oil on open water based on standard coloration.

- i. Total area of oil on open water: NIL

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1066301 JIV report S/N: 0332

ii. Table of average depth of oil on water based on coloration (

\*\*Spill Factors from USCG FOG (2000 Edition)

	Thickness (mm)	Percentage coverage	Volume (m3)
Barely Visible	0.00004		
Silvery	0.00008		
Slight Color	0.00015		
Bright Color	0.0003		
Dull	0.001	<b>NOT APPLICABLE</b>	
Dark	0.002		
Black oil	0.1		
Emulsion (30% Oil)	1		

**5 BARRELS WAS ESTIMATED TO HAVE BEEN CONSUMED BY FIRE WITHIN THREE HOURS BEFORE THE FIRE WAS EXTINGUISHED.**

iii.	Percent Total	100%
	Estimated Volume of oil on open water, V <sub>wat</sub> :	<u>NIL</u> Barrels

24. Calculation of evaporated volume:

i. Estimated Volume available for evaporation within surface area: 3.8 BARRELS

ii. E-Factor: 15%

iii.	Estimated Volume of evaporated oil, V <sub>evap</sub> :	<u>0.67</u> Barrels
------	---	---------------------

Evaporation Factors (E-Factor) for SPDC Crude oil			
Oil Type	Days on site	Bonny Light	Bonny Medium
Oil Residence time	< 1 day	10%	5%
	1-7 days	25%	15%
	> 7 days	40%	25%

25. **Net Estimated Spilled Volume V<sub>net</sub>(bbbls) = V<sub>evap</sub>(bbbls) + V<sub>wat</sub>(bbbls) + V<sub>int</sub>(bbbls) + V<sub>pool</sub>(bbbls) + V<sub>recf</sub>(bbbls) = 0.67 + NIL + 2.98 + 0.82 + NIL = 4.47 BARRELS**

**Estimated Reported Volume\*\* V<sub>rep</sub>(bbbls) = 5 BARRELS (CONSUMED BY FIRE) + 5 BARRELS = 10 BARRELS.**

Calculation of the respective estimated volume is to be done on site as far as practicable using the new spill volume estimation software on site; Conversion of m<sup>3</sup> to barrels is Volume (m3) x 6.29; \*\*Round up estimated volume to next whole number using the following rules:

- Any spill volume in excess of 1 bbl is rounded up to the next whole number.
- Any spill volume in less than 1 bbl is rounded up to the next 0.1 bbl.

Examples: Calculated volume = 15.3 bbl ----- Reported volume = 16 bbl  
 Calculated volume = 0.35 bbl ----- Reported volume = 0.4 bbl  
 Calculated volume = 0.01 bbl ----- Reported volume = 0.1 bbl.

Wherever this estimation tool is not applicable please refer to paragraph 6c (Deviations) of the JIV procedure to use appropriate steps for column estimation; record the calculation in a plain sheet of paper and attach to the JIV report.

26. GENERAL STATUS OF THE SITE

A. Joint investigation of the incident site found that there is no residual impact after the initial response and therefore recommend that the site be closed out

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1066301 JIV report S/N: 0332

B. Investigation of the incident site showed that there is residual impact on site requiring further works

27. REPRESENTATIVES

This report was filled, agreed and signed on the 07/11/2013 by joint investigation representatives from

- Host Community:
- Department of Petroleum Resources [DPR]:
- National Oil Spill Detection and Response Agency [NOSDRA]:
- State Ministry of Environment [SME]:
- Nigeria Police Force [NPF]:
- Shell Petroleum Development Company [SPDC]:
- Signatories agree with reported findings:
- Separate DPR form has been filled out with same findings

*Tick as applicable*

28. Appendix 1: Overview sketch of the site

Location: 24" Nkpoku - Bomi Pipeline at Kipje

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1066301 JIV report S/N: 0332

