

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1118848 JIV report S/N: 0228

(Note: As practicable as possible the JIV report is to be signed in the field by all the participating parties)

A. GENERAL INFORMATION:

1. Spill incident Number: 1118848 2. Type of incident* OIL SPILL
 3. Name of Location 20" OTUMARA-ESCRAVOS PIPELINE
 4. Name of nearest community ULBOEGUNGUN 5. State: DELTA 6. LGA WARRI SOUTH-WEST
 7. Type of Production facility/Installation OIL PIPELINE 8. Asset owner/District PIPELINE

B. INCIDENT INFORMATION:

9. Details of incident

- a. Date of incident: 10TH FEBRUARY, 2014
 b. Start date/time of investigation: 11TH FEBRUARY, 2014 AT 1400HRS
 c. Investigation End date: 11TH FEB. 2014 Actual investigation duration, days: 1 DAY
 d. Description of spill point environment
☐ Firmed soil ☐ Loose soil ☐ Recently excavated area
☐ Under water ☒ Swampy ☐ Exposed pipe surface
☐ Well Platform (on Water) ☐ Drill Rig
 e. Description of leak point (tick as applicable):
☐ Drilled hole ☐ Hack saw cut ☐ Tear (____).
☐ Complete Rupture ☐ Inward dent. ☐ Well head tampering
☒ Failed Weld-on illegal hot tap valve, ☐ Failed Clamp ☐ Missing Pipeline/Flowline
☒ Crude oil theft (illegal bunkering) point. ☐ Third party tampering with Clamp
☐ Third party tampering with valve setting. ☐ Third party tampering with flange.
☐ Corrosion ☐ Saver-pit over flow. ☐ Surge vessel overflow.
☐ Bulging Outward ☐ Flare System/Bund wall failure ☐ Accidental 3rd party equipment impact ☐ Valve Failure ☐ com unit failure ☐ Cold vent
☐ Relief valve failure ☐ Others (specify) _____
 f. Incident caused by:
☒ Third party interference (Sabotage ☐; crude theft ☒; Line theft ☐; Accidental 3rd party damage ☐
☐ Operational ☐ Others (including Mystery spills) _____

g. Spill point coordinates

Measuring unit <u>METERS</u> <u>MINNA (WEST-BELT)</u>	
Northing: <div style="font-size: 1.5em; text-align: center;">178447.94 mN</div>	Easting: <div style="font-size: 1.5em; text-align: center;">305449.29 mE</div>

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1118848 JIV report S/N: 0778

C. RISK ASSESSMENT

10. Type of environment:

☐ Land ☒ Swamp ☐ Water ☐ Seasonal swamp ☐ Shoreline/Waterfront

i. Type of environment to which oil has spread:

☐ Land ☒ Swamp ☐ Water ☐ River (identify) _____

ii. Weather condition

☐ Rain ☒ Sunny ☐ Dry ☐ Wet ☐ Windy ☐ Hot ☐ Cool

11. Distance from the nearest sensitive habitat

- ☐ Government reserved and designated protected area
- ☐ Drinking water source
- ☐ Built up area
- ☐ Farmlands
- ☐ Fish Farm/Pond
- ☐ Fishing net
- ☐ Others (specify).

| .m|
 | .m|
 | .m|
 | .m|
 | .m|
 | .m|
 } **NONE WITHIN THE VICINITY**

12. Containment measures put in place:

☐ Booms ☐ Trench ☐ Dyke ☐ Natural depression ☐ Pit
☐ Others: _____

13. Any pictures or video coverage?

☒ [N]

14. Was there any disruption to the investigation?

[Y] ☒ **NY**

If yes give brief description:

NOT APPLICABLE

D. TYPE/NUMBERS OF PROPERTIES, IF ANY, FOUND WITHIN THE AREA OF SPREAD OF OIL

15. Structures / Properties

S/N	Type of Structures	Description	Size	Number	Comments

NONE WITHIN AREA OF IMPACT

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1118848 JIV report S/N: 0228

16. Crops/Economic Trees

S/N	Type of crops	Young	Medium	Matured	Quantity	Comments
	NONE WITHIN AREA OF IMPACT					

17. Fish/Nets/Ponds


S/N	Fish/Nets/Ponds	Description	Quantity/Size	Comments
	NONE WITHIN AREA OF IMPACT			

18. Others (Specify) i.e. Animal Traps

S/N	Others	Description	Quantity/Size	Comments
	NONE WITHIN AREA OF IMPACT			

E. GRAPHIC DESCRIPTION OF LEAK POINT (while detail report of the leak point should be contained in the leak report, overview sketch of the site should be added as an appendix 1)

4" FAILED WELD-ON ILLEGAL HOT TAP VALVE
AT 12 O' CLOCK POSITION (LEAKING)

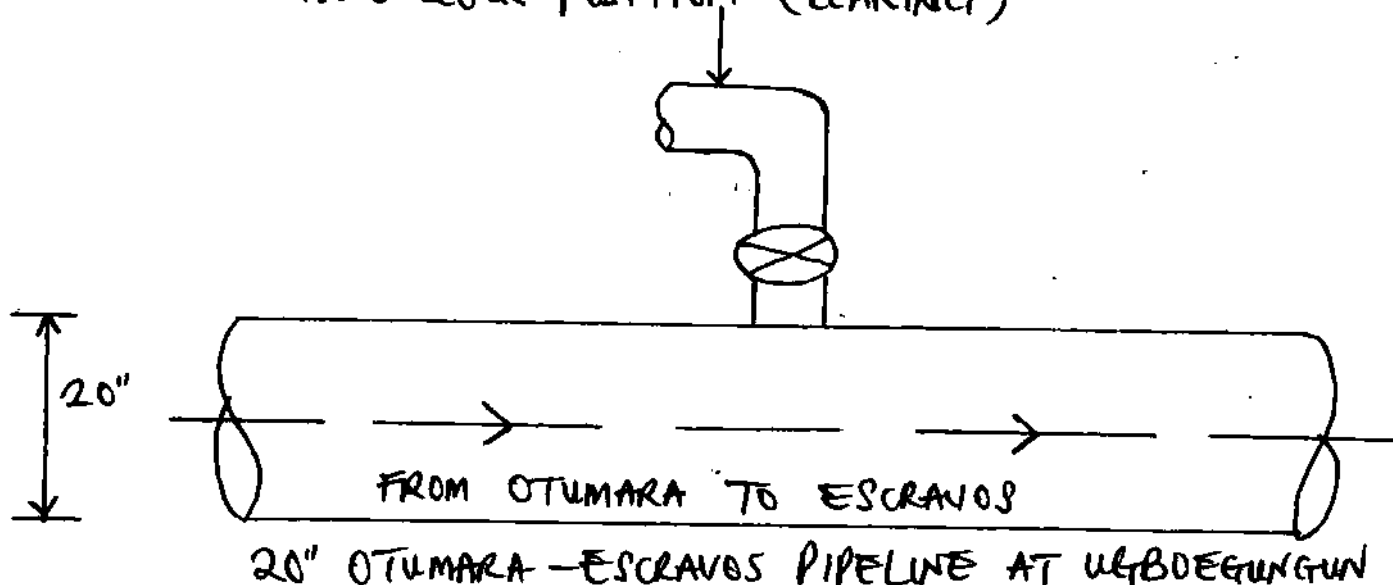

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1118848 JIV report S/N: 0229

19. Impacted area boundary Coordinates (If more, Print and attach as an appendix)

MINNA (WEST BELT)

Page 4 of 9

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1118848 JIV report S/N: 0223

G. INCIDENT INFORMATION:

20. Impacted Area Details

- Total calculated area of impact 300m²
- Impact within SPDC R.O.W YES
- Impact outside SPDC R.O.W NO

21. Volume of oil recovered before completion of JIV (V_{rec}):

Recovered oil V_{rec} :	<u>3.77</u>	Barrels
---------------------------	-------------	---------

22. Computation of estimated residual volume on site

a. Computation of estimated volume of pool of free phase oil (on land or confined water body).

- i. Area (m^2) occupied by pool of free phase oil 35m²
- ii. Average Depth (m) of pool of free phase oil 0.01 m
- iii. Emulsification factor: 30 %

iv. Estimated Volume of pool of free phase oil, V_{pool} :	<u>1.54</u>	barrels
--	-------------	---------

b. Computation of estimated volume of infiltrated oil in the soil (V_{in}).

1. Estimated Volume of infiltrated oil at spill point ($V_{inf a}$)

- i. Area* (m^2) of soil covered by the oil: 10m²
- ii. Average Depth (m) above leaking facility i.e. pipeline/flowline: 0.5m
- iii. Soil type: CLAY
- iv. P_e (effective porosity of the soil): 8 %
- v. Cause of spill: INTERFERENCE
- vi. Oil type: BONNY MEDIUM
- vii. Oil Residence time on site, day: 1 DAY
- viii. Average depth of infiltration below leaking facility i.e. pipeline/flowline: 0.0003m
- ix. Estimated depth of infiltration around spill point: 0.5003m

x. Estimated Volume of infiltrated oil at spill point, $V_{inf a}$:	<u>2.52</u>	barrels
--	-------------	---------

2. Estimated Volume of infiltrated oil at second spill point [if applicable] ($V_{inf b}$)

- i. Area* (m^2) of soil covered by the oil: _____
- ii. Average Depth (m) above leaking facility i.e. pipeline/flowline: _____
- iii. Soil type: _____
- iv. P_e (effective porosity of the soil): _____
- v. Cause of spill: _____
- vi. Oil type: _____
- vii. Oil Residence time on site, day: _____
- viii. Average depth of infiltration below leaking facility i.e. pipeline/flowline: _____
- ix. Estimated depth of infiltration around spill point: _____

Estimated Volume of infiltrated oil at spill point, $V_{inf b}$:	<u>NIL</u>	barrels
---	------------	---------

3. Estimated Volume of infiltrated oil outside immediate spill point(s) region ($V_{inf c}$)

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1118848 JIV report S/N: 0228

- i. Area (m²) of soil covered by the oil: 65 m²
- ii. Area (m²) of the pool of free phase oil in touch with soil: NOT APPLICABLE
- iii. Average Depth (m) below ground surface of infiltration of oil: 0.0003 m
- iv. Soil type: CLAY
- v. P_e (effective porosity of the soil): 8 %

vi.

Estimated Volume of infiltrated oil. At V_{int} :	<u>0.01</u>	barrels
---	-------------	---------

23. Computation of estimated volume of oil on open water based on standard coloration.

- i. Total area of oil on open water: 190 m²
- ii. Table of average depth of oil on water based on coloration (**Spill Factors from USCG FOG (2000 Edition)

	Thickness (mm)	Percentage coverage	Volume (m ³)
Barely Visible	0.00004		
Silvery	0.00008		
Slight Color	0.00015		
Bright Color	0.0003		
Dull	0.001		
Dark	0.002	<u>20 %</u>	<u>0.0001</u>
Black oil	0.1	<u>55 %</u>	<u>0.0105</u>
Emulsion (30% Oil)	1	<u>25 %</u>	<u>0.0143</u>

iii.

Percent Total	100%	
Estimated Volume of oil on open water. V_{wat} :	<u>0.16</u>	Barrels

24. Calculation of evaporated volume:

- i. Estimated Volume available for evaporation within surface area: 7.99 BBLs
- ii. E-Factor: 15 %
- iii.

Estimated Volume of evaporated oil. V_{evap} :	<u>1.41</u>	Barrels
--	-------------	---------

Evaporation Factors (E-Factor) for SPDC Crude oil			
Oil Type	Days on site	Bonny Light	Bonny Medium
Oil Residence time	< 1 day	10%	5%
	1-7 days	25%	15%
	> 7 days	40%	25%

25. Net Estimated Spilled Volume $V_{Est}(bbls) = V_{evap}(bbls) + V_{wat}(bbls) + V_{int}(bbls) + V_{pool}(bbls) + V_{rec}(bbls) = 1.41 + 0.16 + 2.53 + 1.54 + 3.77 = 9.40 BBLs$

Estimated Reported Volume $V_{res}(bbls) = 10 BBLs$**

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1118848 JIV report S/N: 0278

*Calculation of the respective estimated volume is to be done on site as far as practicable using the new spill volume estimation software on site. Conversion of m³ to barrels is Volume (m³) x 6.29. **Round up estimated volume to next whole number using the following rules:*

- Any spill volume in excess of 1 bbl is rounded up to the next whole number.
- Any spill volume in less than 1 bbl is rounded up to the next 0.1 bbl.

Examples:
Calculated volume = 15.3 bbl ----- Reported volume = 16 bbl
Calculated volume = 0.35 bbl ----- Reported volume = 0.4 bbl
Calculated volume = 0.01 bbl ----- Reported volume = 0.1 bbl.

Wherever this estimation tool is not applicable please refer to paragraph 6c (Deviations) of the JIV procedure to use appropriate steps for column estimation; record the calculation in a plain sheet of paper and attach to the JIV report.

26. GENERAL STATUS OF THE SITE

- | |
|--|
| A. Joint investigation of the incident site found that there is no residual impact after the initial response and therefore recommend that the site be closed out <input type="checkbox"/> |
| B. Investigation of the incident site showed that there is residual impact on site requiring further works <input checked="" type="checkbox"/> |

27. REPRESENTATIVES

This report was filled, agreed and signed on the 11 / 2 / 2014 by joint investigation representatives from

- Host Community: ☒
- Department of Petroleum Resources [DPR]: ☒
- National Oil Spill Detection and Response Agency [NOSDRA]: ☒
- State Ministry of Environment [SME]: ☒
- Nigeria Police Force [NPF]: ☒
- Shell Petroleum Development Company [SPDC]: ☒
- Signatories agree with reported findings: ☒
- Separate DPR form has been filled out with same findings ☒

Tick as applicable

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1118848 JIV report S/N: 0228

28 Appendix 1: Overview sketch of the site

Location: 20" OTUMARA — ESCRAVOS PIPELINE AT UGBOEGUNGUN

