

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1212856 JIV report S/N: 00589

(Note: As practicable as possible the JIT report is to be signed in the field by all the participating parties)

A. GENERAL INFORMATION:

1. Spill incident Number: 1212856 2. Type of incident* OIL SPILL
 3. Name of Location ADIBAWA Well-23L 4" FLOWLINE
 4. Name of nearest community EDAKBIRI 5. State: RIVERS 6. LGA AHODA WEST
 7. Type of Production facility/Installation FLOWLINE 8. Asset owner/District LAND II | ADIBAWA

B. INCIDENT INFORMATION:

9. Details of incident

- a. Date of incident: 11TH JULY, 2014
 b. Start date/time of investigation: 15TH JULY, 2014
 c. Investigation End date: 15TH JULY 2014 Actual investigation duration, days: ONE DAY
 d. Description of spill point environment

- | | | |
|---|-------------------------------------|--|
| <input checked="" type="checkbox"/> Firmed soil | <input type="checkbox"/> Loose soil | <input type="checkbox"/> Recently excavated area |
| <input type="checkbox"/> Under water | <input type="checkbox"/> Swampy | <input checked="" type="checkbox"/> Exposed pipe surface |
| <input type="checkbox"/> Well Platform (on Water) | | <input type="checkbox"/> Drill Rig |

Additional observations around the spill point:

e. Description of leak point (tick as applicable);

- | | | |
|---|---|---|
| <input type="checkbox"/> Drilled hole | <input checked="" type="checkbox"/> Hack saw cut | <input type="checkbox"/> Tear (_____), |
| <input type="checkbox"/> Complete Rupture | <input type="checkbox"/> Inward dent, | <input type="checkbox"/> Well head tampering |
| <input type="checkbox"/> Failed Weld-on illegal hot tap valve, | <input type="checkbox"/> Failed Clamp | <input type="checkbox"/> Missing Pipeline/Flowline |
| <input type="checkbox"/> Crude oil theft (illegal bunkering) point, | | <input type="checkbox"/> Third party tampering with Clamp |
| <input type="checkbox"/> Third party tampering with valve setting, | | <input type="checkbox"/> Third party tampering with flange, |
| <input type="checkbox"/> Corrosión | <input type="checkbox"/> Saver-pit over flow, | <input type="checkbox"/> Surge vessel overflow, |
| <input type="checkbox"/> Bulging Outward | <input type="checkbox"/> Flare System/Bund wall failure | <input type="checkbox"/> Accidental 3 rd party equipment |
| impact | <input type="checkbox"/> Valve Failure | <input type="checkbox"/> com unit failure |
| <input type="checkbox"/> Relief valve failure | <input type="checkbox"/> Others (specify) _____ | <input type="checkbox"/> Cold vent |

f. Incident caused by:

- Third party interference (Sabotage , crude theft ; Line theft ; Accidental 3rd party damage
 Operational Others (including Mystery spills) _____

**This can be: a) Oil Spill b) Drilling fluid/Chemical c) Siltation d) construction e) Encroachment f) Fire.*

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1212856 JIV report S/N: 00589

g. Spill point coordinates

Measuring unit <u>(m)</u> <u>Minna Mid belt</u>	
Northing:	Easting:
<u>132910.18</u>	<u>447838.97</u>
<u>[Signature]</u>	<u>[Signature]</u>

C. RISK ASSESSMENT

10. Type of environment:

- Land Swamp Water Seasonal swamp Shoreline/Waterfront

i. Type of environment to which oil has spread:

- Land Swamp Water River (identify) _____

ii. Weather condition

- Rain Sunny Dry Wet Windy Hot Cool

11. Distance from the nearest sensitive habitat

- Government reserved and designated protected area
- Drinking water source
- Built up area
- Farmlands
- Fish Farm/Pond
- Fishing net
- Others (specify).

[,m] } NONE SEEN
 [,m] } WITHIN
 [,m] } VICINITY.
 [,m]
 [,m]

12. Containment measures put in place;

- Booms Trench Dyke Natural depression Pit None
 Others: _____

13. Any pictures or video coverage? [Y] [N]

14. Further response/repair initiated as at the time of JIV? [Y] [N]

If yes to item 14, give brief description:

REPAIR COMPLETED BY CLAMPING.

15. Was there any disruption to the investigation? [Y] [N]

If yes to item 15 give brief description:

NOT APPLICABLE.

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1212R56 JIV report S/N: 00589

D. TYPE/NUMBERS OF PROPERTIES, IF ANY, FOUND WITHIN THE AREA OF SPREAD OF OIL

16. Structures / Properties

S/N	Type of Structures	Description	Size	Number	Comments
	NONE WITHIN AREA OF IMPACT				

17. Crops/Economic Trees

S/N	Type of crops	Young	Medium	Matured	Quantity	Comments
	NONE WITHIN AREA OF IMPACT					

18. Fish/Nets/Ponds

S/N	Fish/Nets/Ponds	Description	Quantity/Size	Comments
	NONE WITHIN AREA OF IMPACT			

19. Others (Specify) i.e. Animal Traps

S/N	Others	Description	Quantity/Size	Comments
	NONE WITHIN AREA OF IMPACT			


E. GRAPHIC DESCRIPTION OF LEAK POINT (while detail report of the leak point should be contained in the leak report, overview sketch of the site should be added as an appendix 1)

SECTIONAL VIEW OF ANBAWA WELL 23L 4" FLOWLINE AT EDAGE
SHOWING (HACKSAW CUT) SABOTAGE SPILL

LEAK IS DUE TO

60mm LENGTH OF HACKSAW
CUT WITH EFFECTIVE CUT.
OF 10mm AT 11 O'CLOCK
POSITION.

40mm of ATTEMPTED CUT
WITHOUT EFFECTIVE CUT AND
IT IS 10mm AWAY FROM THE
LEAK CUT.

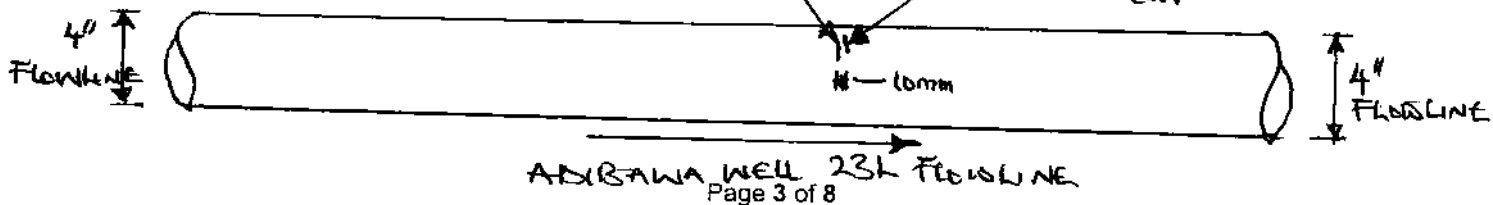

ESTIMATION OF OIL SPILL VOLUME

FID =1212856 AT 4" ADIBAWA WELL23L FLOWLINE AT EDAGBIRI JIV VOLUME CAL REPORT

A OIL SPILLED ONSHORE/OFFSHORE (Leak stopped at source)

Impacted Area Details

Total Calculated Area of Impact

- i Impact within SPDC R.O.W
- ii Impact outside SPDC R.O.W

50.00	m ²
	m ²
	m ²

1 Volume of oil recovered before completion of JIV (V_{rec})

- i Estimated Recovered oil (Net)

	bbbls
--	-------

Estimated Recovered oil (Net) V _{rec}	0.00	bbbls
--	------	-------

2 Computation of estimated residual volume on site

a Computation of volume of free phase oil (on land or confined water body)

- i Total area occupied by pool of free phase oil
- ii Average depth of pool of free phase oil
- iii Emulsification factor (If applicable, else 0%)

37.00	m ²
0.010	m
30.000	%

Estimated Volume of pool of free phase oil, V _{pool}	0.26	m ³
---	------	----------------

Estimated Volume of pool of free phase oil, V _{pool}	1.63	bbbls
---	------	-------

b Computation of estimated volume of infiltrated oil in the soil (V_{inf})

1 Volume of infiltrated oil at spill point (V_{inf1})

- i Total area covered by the oil (infiltration)
- ii Average depth of infiltration above leaking facility i.e. pipeline/flowline
- iii Soil type
- iv P_e (effective porosity of the soil)

4.00	m ²
0.001	m
Silt	
	%

- v Cause of spill

Third party interference	
--------------------------	--

vi Calculation of days for infiltration below the leaking point on pipeline or flowline

Incident Date	JIV Date	Days on Site
7/11/2014 13:40	7/15/2014 14:35	4
if 'cause of spill' is operational, use 1 week as worst case scenario except where 'days on site' exceeds 7.		7

Infiltration of oil types in various soil types vs time.				
Oil type	Soil type	Approximate time to reach 1m depth below ground level		
		Sand	Loam	Clay
Bonny Medium		3 weeks	3 years	> 10 years
Bonny Light		2 days	2 months	> 10 years

- vii Oil type

Bonny Medium	
--------------	--

- viii Average depth of infiltration below leaking facility i.e. pipeline/flowline

	m
--	---

- ix Total depth below ground surface of infiltration of oil

	m
--	---

Estimated Volume of infiltrated oil, V _{inf1}	0.00	m ³
--	------	----------------

Estimated Volume of infiltrated oil, V _{inf1}	0.02	bbbls
--	------	-------

2 Volume of infiltrated oil at second spill point (if applicable) (V_{inf2})

- i Total area covered by the oil (infiltration)
- ii Average depth of infiltration above leaking facility i.e. pipeline/flowline
- iii Soil type
- iv P_e (effective porosity of the soil)

	m ²
	m
Silt	
	%

- v Average depth of infiltration below leaking facility i.e. pipeline/flowline

	m
--	---

- vi Total depth below ground surface of infiltration of oil

	m
--	---

Estimated Volume of infiltrated oil, V _{inf2}	0.00	m ³
--	------	----------------

Estimated Volume of infiltrated oil, V _{inf2}	0.00	bbbls
--	------	-------

3 Volume of infiltrated oil outside immediate spill point(s) region (V_{inf3})

- i Total Area covered by the oil (infiltration)
- ii Total Area of the pool of free phase oil in touch with soil
- iii Soil type
- iv P_e (effective porosity of the soil)

9.00	m ²
	m ²
Silt	
	%

- v Average depth below ground surface of infiltration of oil

	m
--	---

Estimated Volume of infiltrated oil, V _{inf3}	0.01	m ³
--	------	----------------

Estimated Volume of infiltrated oil, V _{inf3}	0.04	bbbls
--	------	-------

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1212856 JIV report S/N: **00589**

G. INCIDENT INFORMATION:

20. Impacted Area Details

- Total calculated area of impact 0.005 ha
- Impact within SPDC R.O.W YES
- Impact outside SPDC R.O.W NO

21. Volume of oil recovered before completion of JIV (V_{rec}):

Recovered oil V_{rec} :	NIL	Barrels
---------------------------	------------	---------

Controlled recovery/evacuation from source with no impact to environment:

NIL	Barrels
------------	---------

22. Net Estimated Spilled Volume V_{est} (bbls)* =

2.00 BARRELS

Estimated Reported Volume V_{rep} (bbls)=**

2 BARRELS

***Notes:**

- Volume estimation was done using an excel based tool. (see attached for details on the calculation)
- Reported spilled volume is an estimate

Write other relevant notes taken into consideration for estimating the spilled in the box below:

Calculation of the respective estimated volume is to be done on site as far as practicable using the new spill volume estimation software on site; Conversion of m^3 to barrels is $Volume (m^3) \times 6.29$; **Round up estimated volume to next whole number using the following rules:

- Any spill volume in excess of 1 bbl is rounded up to the next whole number.
- Any spill volume in less than 1 bbl is rounded up to the next 0.1 bbl.

Examples: Calculated volume = 15.3 bbl ----- Reported volume = 16 bbl
 Calculated volume = 0.35 bbl ----- Reported volume = 0.4 bbl
 Calculated volume = 0.01 bbl ----- Reported volume = 0.1 bbl.

Wherever this estimation tool is not applicable please refer to paragraph 6c (Deviations) of the JIV procedure to use appropriate steps for column estimation; record the calculation in a plain sheet of paper and attach to the JIV report.

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 121256 JIV report S/N: **00589**

23. GENERAL STATUS OF THE SITE

A. Joint investigation of the incident site found that there is no residual impact after the initial response and JIT therefore recommend that the site be closed out <input type="checkbox"/>
B. Investigation of the incident site showed that there is residual impact on site requiring further works <input checked="" type="checkbox"/>

24. REPRESENTATIVES

This report was filled, agreed and signed by the following joint investigation representatives:

- Host Community:
- Department of Petroleum Resources [DPR]:
- National Oil Spill Detection and Response Agency [NOSDRA]:
- State Ministry of Environment [SME]:
- Nigeria Police Force [NPF]:
- Shell Petroleum Development Company [SPDC]:
- Signatories agree with reported findings:
- Separate DPR form has been filled out with same findings

Tick as applicable

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1242856 JIV report S/N: 00589

25. Appendix 1: Overview sketch of the site

