

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1216353 JIV report S/N: 00615

(Note: As practicable as possible the JIT report is to be signed in the field by all the participating parties)

A. GENERAL INFORMATION:

1. Spill incident Number: 1216353 2. Type of incident* OIL SPILL
 3. Name of Location 12" IMO RIVER — OGALE PIPELINE
 4. Name of nearest community KOMKOM 5. State: RIVERS 6. LGA OYIGBO
 7. Type of Production facility/Installation PIPELINE 8. Asset owner/District PIPELINE

B. INCIDENT INFORMATION:

9. Details of incident

- a. Date of incident: 19TH JULY 2014
 b. Start date/time of investigation: 21ST JULY 2014 / 10:45 HRS
 c. Investigation End date: 21ST JULY 2014 Actual investigation duration, days: ONE (1) DAY
 d. Description of spill point environment

- | | | |
|---|--|---|
| <input type="checkbox"/> Firmed soil | <input checked="" type="checkbox"/> Loose soil | <input checked="" type="checkbox"/> Recently excavated area |
| <input type="checkbox"/> Under water | <input type="checkbox"/> Swampy | <input type="checkbox"/> Exposed pipe surface |
| <input type="checkbox"/> Well Platform (on Water) | | <input type="checkbox"/> Drill Rig |

Additional observations around the spill point: SAND BAGS WAS OBSERVED AT THE SPILL POINT DURING THE JOINT INVESTIGATION.

e. Description of leak point (tick as applicable);

- | | | |
|--|---|---|
| <input type="checkbox"/> Drilled hole | <input type="checkbox"/> Hack saw cut | <input type="checkbox"/> Tear (_____). |
| <input type="checkbox"/> Complete Rupture | <input type="checkbox"/> Inward dent, | <input type="checkbox"/> Well head tampering |
| <input type="checkbox"/> Failed Weld-on illegal hot tap valve, | <input type="checkbox"/> Failed Clamp | <input type="checkbox"/> Missing Pipeline/Flowline |
| <input checked="" type="checkbox"/> Crude oil theft (illegal bunkering) point, | | <input type="checkbox"/> Third party tampering with Clamp |
| <input type="checkbox"/> Third party tampering with valve setting, | | <input type="checkbox"/> Third party tampering with flange, |
| <input type="checkbox"/> Corrosion | <input type="checkbox"/> Saver-pit over flow, | <input type="checkbox"/> Surge vessel overflow, |
| <input type="checkbox"/> Bulging Outward | <input type="checkbox"/> Flare System/Bund wall failure | <input type="checkbox"/> Accidental 3 rd party equipment |
| impact | <input type="checkbox"/> Valve Failure | <input type="checkbox"/> com unit failure |
| <input type="checkbox"/> Relief valve failure | <input type="checkbox"/> Others (specify) _____ | <input type="checkbox"/> Cold vent |

f. Incident caused by:

- Third party interference (Sabotage ; crude theft ; Line theft ; Accidental 3rd party damage
 Operational Others (including Mystery spills) _____

*This can be: a) Oil Spill b) Drilling fluid/Chemical c) Siltation d) construction e) Encroachment f) Fire,

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1216353 JIV report S/N: 00615

g. Spill point coordinates

Measuring unit (M)		<u>MOUNT MID-BELT</u>	
Northing:	Easting:		
<u>94 134.39</u>	<u>521 777.77</u>		
/	/		

C. RISK ASSESSMENT

10. Type of environment:

- Land Swamp Water Seasonal swamp Shoreline/Waterfront

i. Type of environment to which oil has spread:

- Land Swamp Water River (identify) _____

ii. Weather condition

- Rain Sunny Dry Wet Windy Hot cool

11. Distance from the nearest sensitive habitat

- Government reserved and designated protected area [< 50 ,m]
- Drinking water source [< 50 ,m]
- Built up area [< 50 ,m]
- Farmlands [< 50 ,m]
- Fish Farm/Pond **NOT APPLICABLE**
- Fishing net [,m]
- Others (specify).

12. Containment measures put in place;

- Booms Trench Dyke Natural depression Pit None
 Others: _____

13. Any pictures or video coverage? [N]

14. Further response/repair initiated as at the time of JIV? [N]

If yes to item 14, give brief description:

THE REPAIR TEAM CLAMPED THE CRUDE
THEFT POINT

15. Was there any disruption to the investigation? [Y] [N]

If yes to item 15 give brief description:

NOT APPLICABLE

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1216353 JIV report S/N: 00615

D. TYPE/NUMBERS OF PROPERTIES, IF ANY, FOUND WITHIN THE AREA OF SPREAD OF OIL

16. Structures / Properties

S/N	Type of Structures	Description	Size	Number	Comments
NON WITHIN AREA OF IMPACT					

17. Crops/Economic Trees

S/N	Type of crops	Young	Medium	Matured	Quantity	Comments
1	CASSAVA	—	YES	YES	FEW	IMPACTED BY CRUDE
2	VEGETABLE	—	YES	YES	FEW	OK

18. Fish/Nets/Ponds


S/N	Fish/Nets/Ponds	Description	Quantity/Size	Comments
NON WITHIN AREA OF IMPACT				

19. Others (Specify) i.e. Animal Traps

S/N	Others	Description	Quantity/Size	Comments
NON WITHIN AREA OF IMPACT				

E. GRAPHIC DESCRIPTION OF LEAK POINT (while detail report of the leak point should be contained in the leak report, overview sketch of the site should be added as an appendix 1)

SECTION OF
12" IMD RIVER - OGALE
PIPELINE AT KOMKOM
SHOWING 2" CRUDE THEFT
VALVE AND A DRILLED
HOLE WITHOUT VALVE
AT 12 O'CLOCK POSITIONS
20CM APART.

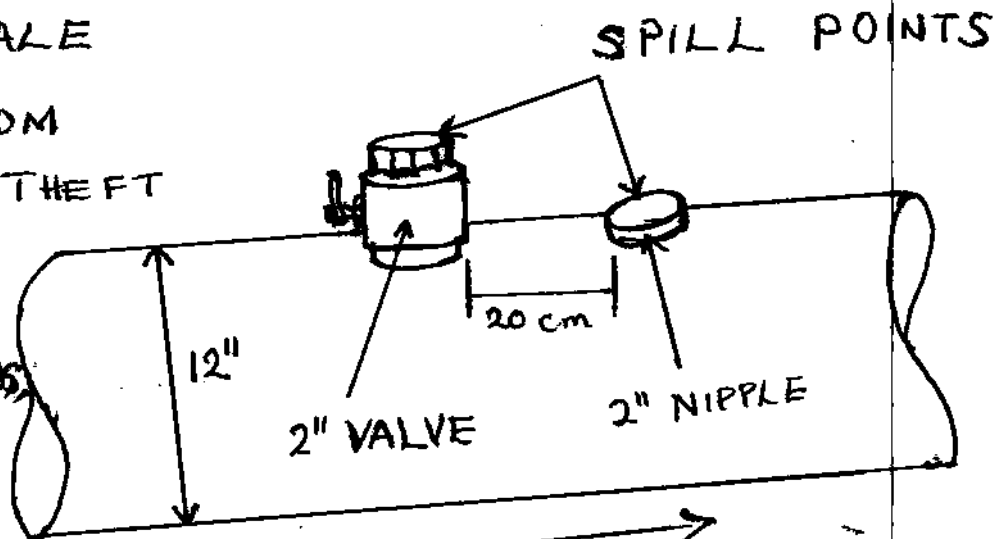

FROM IMD RIVER TO OGALE

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1216353 JIV report S/N: 00615

F: TABLE SHOWING SOME OF COORDINATES TAKEN DURING JIV FOR AREA CALCULATION

20. Impacted area boundary Coordinates (If more, Print and attach as an appendix)

S/N	Northing (m)	Easting (m)

SEE ATTACHED APPENDIX A

MUNA MID-BELT

APPENDIX A		
JIV_KOMKOM_1216353 (MINNA MID-BELT)		
Name	East2	North2
SPILL POINT		
p236	521777.77	94134.39
AREA IMPACTED (HEAVY)		
p237	521799.34	94137.42
p238	521796.25	94131.28
p239	521783.92	94131.31
p240	521777.76	94131.32
p241	521774.65	94115.97
p242	521774.63	94106.75
p243	521768.42	94085.26
p244	521762.21	94060.7
p245	521762.19	94048.41
p246	521762.14	94026.91
p247	521759.05	94017.7
p248	521755.9	93983.92
p249	521752.73	93940.92
p250	521749.52	93876.42
p251	521740.23	93851.86
p252	521733.95	93796.58
p253	521730.82	93772.01
p254	521730.78	93747.44
p255	521724.58	93732.09
p256	521718.35	93698.31
p257	521708.98	93633.83
p258	521712.02	93612.32
p259	521711.98	93593.89
p260	521708.88	93584.68
p261	521705.81	93587.75
p262	521702.7	93575.47
p263	521702.69	93569.33
p264	521702.68	93563.19
p265	521687.27	93563.22
p266	521699.61	93572.41
p267	521705.18	93588.62
p268	521711.1	93596.91
p269	521708.96	93621.54
p270	521708.14	93634.12
p271	521712.16	93682.97
p272	521717.73	93698.39
p273	521724.59	93735.16
p274	521730.86	93787.37
p275	521734.02	93827.3
p276	521715.53	93827.34
p277	521731.15	93828.03

p278	521746.49	93904.07	
p279	521749.65	93940.93	
p280	521752.89	94023.86	
p282	521759.12	94057.63	
p283	521765.36	94094.48	
p284	521759.21	94100.64	
p285	521771.55	94106.76	
p286	521771.61	94137.48	
p287	521774.7	94143.61	
CONTAINMMENT PITS			
p242	521774.63	94106.75	
p246	521762.14	94026.91	
p263	521702.69	93569.33	
p278	521746.49	93904.07	
p282	521759.12	94057.63	
p287	521774.7	94143.61	

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1216353 JIV report S/N: **00615**

G. INCIDENT INFORMATION:

20. Impacted Area Details

- Total calculated area of impact 0.2454Hq
- Impact within SPDC R.O.W YES
- Impact outside SPDC R.O.W YES

21. Volume of oil recovered before completion of JIV (V_{rec}):

Recovered oil V_{rec} :	20	Barrels
---------------------------	-----------	---------

Controlled recovery/evacuation from source with no impact to environment:

NIL	Barrels
------------	---------

22. Net Estimated Spilled Volume V_{est} (bbls)* =	55.67 BARRELS
Estimated Reported Volume** V_{rep} (bbls)=	56 BARRELS

**Notes:*

- Volume estimation was done using an excel based tool. (see attached for details on the calculation)
- Reported spilled volume is an estimate

Write other relevant notes taken into consideration for estimating the spilled in the box below:

NOT APPLICABLE

*Calculation of the respective estimated volume is to be done on site as far as practicable using the new spill volume estimation software on site: Conversion of m^3 to barrels is Volume (m^3) x 6.29; **Round up estimated volume to next whole number using the following rules:*

- Any spill volume in excess of 1 bbl is rounded up to the next whole number.
- Any spill volume in less than 1 bbl is rounded up to the next 0.1 bbl.

Examples: Calculated volume = 15.3 bbl ----- Reported volume = 16 bbl
 Calculated volume = 0.35 bbl ----- Reported volume = 0.4 bbl
 Calculated volume = 0.01 bbl ----- Reported volume = 0.1 bbl.

Wherever this estimation tool is not applicable please refer to paragraph 6c (Deviations) of the JIV procedure to use appropriate steps for column estimation; record the calculation in a plain sheet of paper and attach to the JIV report.

ESTIMATION OF OIL SPILL VOLUME

A OIL SPILLED ONSHORE/OFFSHORE (Leak stopped at source)

Impacted Area Details

Total Calculated Area of Impact

- i Impact within SPDC R.O.W
- ii Impact outside SPDC R.O.W

2,454.00	m ²
	m ²
	m ²

1 Volume of oil recovered before completion of JIV (V_{rec})

- i Estimated Recovered oil (Net)

20.00	bbbls
-------	-------

Estimated Recovered oil (Net) V_{rec}	20.00 bbbls
--	--------------------

2 Computation of estimated residual volume on site

a Computation of volume of free phase oil (on land or confined water body)

- i Total area occupied by pool of free phase oil
- ii Average depth of pool of free phase oil
- iii Emulsification factor (If applicable, else 0%)

100.00	m ²
0.040	m
0.000	%

Estimated Volume of pool of free phase oil, V_{pool}

4.00	m ³
------	----------------

Estimated Volume of pool of free phase oil, V_{pool}	25.16 bbbls
---	--------------------

b Computation of estimated volume of infiltrated oil in the soil (V_{inf a})

1 Volume of infiltrated oil at spill point (V_{inf a})

- i Total area covered by the oil (infiltration)
- ii Average depth of infiltration above leaking facility i.e. pipeline/flowline
- iii Soil type
- iv P_e (effective porosity of the soil)

1.00	m ²
1.200	m
Silt	
21	%

- v Cause of spill

Third party interference

vi Calculation of days for infiltration below the leaking point on pipeline or flowline

Incident Date	JIV Date	Days on Site
7/19/2014 13:40	7/21/2014 14:45	2
If 'cause of spill' is operational, use 1 week as worst case scenario except where 'days on site' exceeds 7.		7

Infiltration of oil types in various soil types vs time.			
Soil type	Approximate time to reach 1m depth below ground level		
Oil type	Sand	Loam	Clay
Bonny Medium	3 weeks	3 years	> 10 years
Bonny Light	2 days	2 months	> 10 years

- vii Oil type

Bonny Medium

- viii Average depth of infiltration below leaking facility i.e. pipeline/flowline

0.002	m
-------	---

- ix Total depth below ground surface of infiltration of oil

1.202	m
-------	---

Estimated Volume of infiltrated oil, V_{inf a}

0.25	m ³
------	----------------

Estimated Volume of infiltrated oil, V_{inf a}	1.89 bbbls
---	-------------------

2 Volume of infiltrated oil at second spill point [if applicable] (V_{inf b})

- i Total area covered by the oil (infiltration)
- ii Average depth of infiltration above leaking facility i.e. pipeline/flowline
- iii Soil type
- iv P_e (effective porosity of the soil)

	m ²
	m
Silt	
21	%

- v Average depth of infiltration below leaking facility i.e. pipeline/flowline

0.002	m
-------	---

- vi Total depth below ground surface of infiltration of oil

0.002	m
-------	---

Estimated Volume of infiltrated oil, V_{inf b}

0.00	m ³
------	----------------

Estimated Volume of infiltrated oil, V_{inf b}	0.00 bbbls
---	-------------------

3 Volume of infiltrated oil outside immediate spill point(s) region (V_{inf c})

i Total Area covered by the oil (infiltration)	1,379.00 m ²
ii Total Area of the pool of free phase oil in touch with soil	100.00 m ²
iii Soil type	Silt
iv P _e (effective porosity of the soil)	21 %
v Average depth below ground surface of infiltration of oil	0.002 m
Estimated Volume of Infiltrated oil, V_{inf c}	0.57 m³
Estimated Volume of Infiltrated oil, V_{inf c}	3.57 bbls
Estimated Total Volume of Infiltrated oil, V_{inf}	0.82 m³
Estimated Total Volume of Infiltrated oil, V_{inf}	5.16 bbls

c Computation of volume of oil on open water based on standard coloration

- i Total area of oil on open water [] m²
- ii Table of average depth of oil on water based on coloration

[Link to Coverage Visual](#)

Spill Factors from USCG FOG (2000 Edition)

	Thickness (mm)	Percentage coverage (%)	Volume (m3)
Barely Visible	0.00004		0.0000
Silvery	0.00008		0.0000
Slight Color	0.00015		0.0000
Bright Color	0.0003		0.0000
Dull	0.001		0.0000
Dark	0.002		0.0000
Black oil	0.1		0.0000
Emulsion (30% Oil)	1		0.0000
Percent Total:		0%	0.0000

Estimated Volume of oil on open water, V_{wat}	0.00 m³
Estimated Volume of oil on open water, V_{wat}	0.00 bbls

3 Calculation of evaporated volume

Evaporation Factors (E-Factor) for SPDC Crude oil		
Residence time of spilled oil (days on site)	Oil type	
	Bonny Light	Bonny Medium
< 1 day	10%	5%
1-7 days	25%	15%
> 7 days	40%	25%

- i Was oil recovery before JIV completion done before JIV date? Yes
- ii Estimated volume available for evaporation 30.32 bbls
- iii E-factor 15 %

Estimated Volume of evaporated oil, V_{evap}	6.36 bbls
Net Total Estimated Spilled Volume, V_{Est}	55.67 bbls

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1216353 JIV report S/N: **00615**

23. GENERAL STATUS OF THE SITE

A. Joint investigation of the incident site found that there is no residual impact after the initial response and JIT therefore recommend that the site be closed out <input type="checkbox"/>
B. Investigation of the incident site showed that there is residual impact on site requiring further works <input checked="" type="checkbox"/>

24. REPRESENTATIVES

This report was filled, agreed and signed by the following joint investigation representatives:

- Host Community
- Department of Petroleum Resources [DPR]
- National Oil Spill Detection and Response Agency [NOSDRA]
- State Ministry of Environment [SME]
- Nigeria Police Force [NPF]
- Shell Petroleum Development Company [SPDC]
- Signatories agree with reported findings
- Separate DPR form has been filled out with same findings

Tick as applicable

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1216353 JIV report S/N: 00615

25. Appendix 1: Overview sketch of the site

