

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1134131 JIV report S/N: 0404

(Note: As practicable as possible the JIT report is to be signed in the field by all the participating parties)

A. GENERAL INFORMATION:

1. Spill incident Number: 1134131 2. Type of incident* OIL SPILL
 3. Name of Location IMO RIVER 2 WELL 28L WELL HEAD
UMUEDEOKWARA
 4. Name of nearest community (ODDAGWA) 5. State: RIVERS 6. LGA ETCHE
 7. Type of Production facility/Installation WELL HEAD 8. Asset owner/District LAND 1

B. INCIDENT INFORMATION:

9. Details of incident

- a. Date of incident: 3RD MARCH 2014
 b. Start date/time of investigation: 6TH MARCH 2014 / 12:23 HOURS
 c. Investigation End date: 6TH MARCH 2014 Actual investigation duration, days: ONE (1) DAY
 d. Description of spill point environment 2014

- Firmed soil Loose soil Recently excavated area
 Under water Swampy Exposed pipe surface
 Well Platform (on Water) ON LAND Drill Rig
 e. Description of leak point (tick as applicable);
 Drilled hole Hack saw cut Tear (_____),
 Complete Rupture Inward dent, Well head tampering
 Failed Weld-on illegal hot tap valve, Failed Clamp Missing Pipeline/Flowline
 Crude oil theft (illegal bunkering) point, Third party tampering with Clamp
 Third party tampering with valve setting, Third party tampering with flange,
 Corrosion Saver-pit over flow, Surge vessel overflow,
 Bulging Outward Flare System/Bund wall failure Accidental 3rd party
 equipment impact Valve Failure com unit failure Cold vent

Relief valve failure Others (specify) KEROTEST VALVE REMOVAL BY UNKNOWN PERSON

f. Incident caused by:

- Third party interference (Sabotage ; crude theft ; Line theft ; Accidental 3rd party damage
 Operational Others (including Mystery spills) _____

g. Spill point coordinates

Measuring unit <u>METERS</u> <u>MINNA MID-BELT</u>	
Northing: <p align="center"><u>109788.75</u></p>	Easting: <p align="center"><u>522440.00</u></p>

*This can be: a) Oil Spill b) Drilling fluid/Chemical c) Siltation d) construction e) Encroachment f) Fire.

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1134131 JIV report S/N: 0404

C. RISK ASSESSMENT

10. Type of environment:

- Land Swamp Water Seasonal swamp Shoreline/Waterfront

i. Type of environment to which oil has spread:

- Land Swamp Water River (identify) _____

ii. Weather condition

- Rain Sunny Dry Wet Windy Hot Cool

11. Distance from the nearest sensitive habitat

- Government reserved and designated protected area [,m]
 - Drinking water source [,m]
 - Built up area [,m]
 - Farmlands [,m]
 - Fish Farm/Pond [,m]
 - Fishing net [,m]
 - Others (specify). [,m]
- NONE
OBSERVED
WITHIN IMMEDIATE
VICINITY

12. Containment measures put in place;

- Booms Trench Dyke Natural depression Pit
 Others: _____

13. Any pictures or video coverage?

[] [N]

14. Was there any disruption to the investigation?

[Y] [N]

If yes give brief description:

NOT APPLICABLE

D. TYPE/NUMBERS OF PROPERTIES, IF ANY, FOUND WITHIN THE AREA OF SPREAD OF OIL

15. Structures / Properties

S/N	Type of Structures	Description	Size	Number	Comments
NONE WITHIN AREA OF IMPACT					

16. Crops/Economic Trees

S/N	Type of crops	Young	Medium	Matured	Quantity	Comments
NONE WITHIN AREA OF IMPACT						

17. Fish/Nets/Ponds


S/N	Fish/Nets/Ponds	Description	Quantity/Size	Comments
NONE WITHIN AREA OF IMPACT				

18. Others (Specify) i.e. Animal Traps

S/N	Others	Description	Quantity/Size	Comments
NONE WITHIN AREA OF IMPACT				

E. GRAPHIC DESCRIPTION OF LEAK POINT (while detail report of the leak point should be contained in the leak report, overview sketch of the site should be added as an appendix 1)

SECTION OF
IMU RIVER 2
WELL 28L
WELL HEAD AT
UMUEDEOKWARA
(ODAGWA)
SHOWING
POSITION OF
MISSING KEROTEST
VALVE.

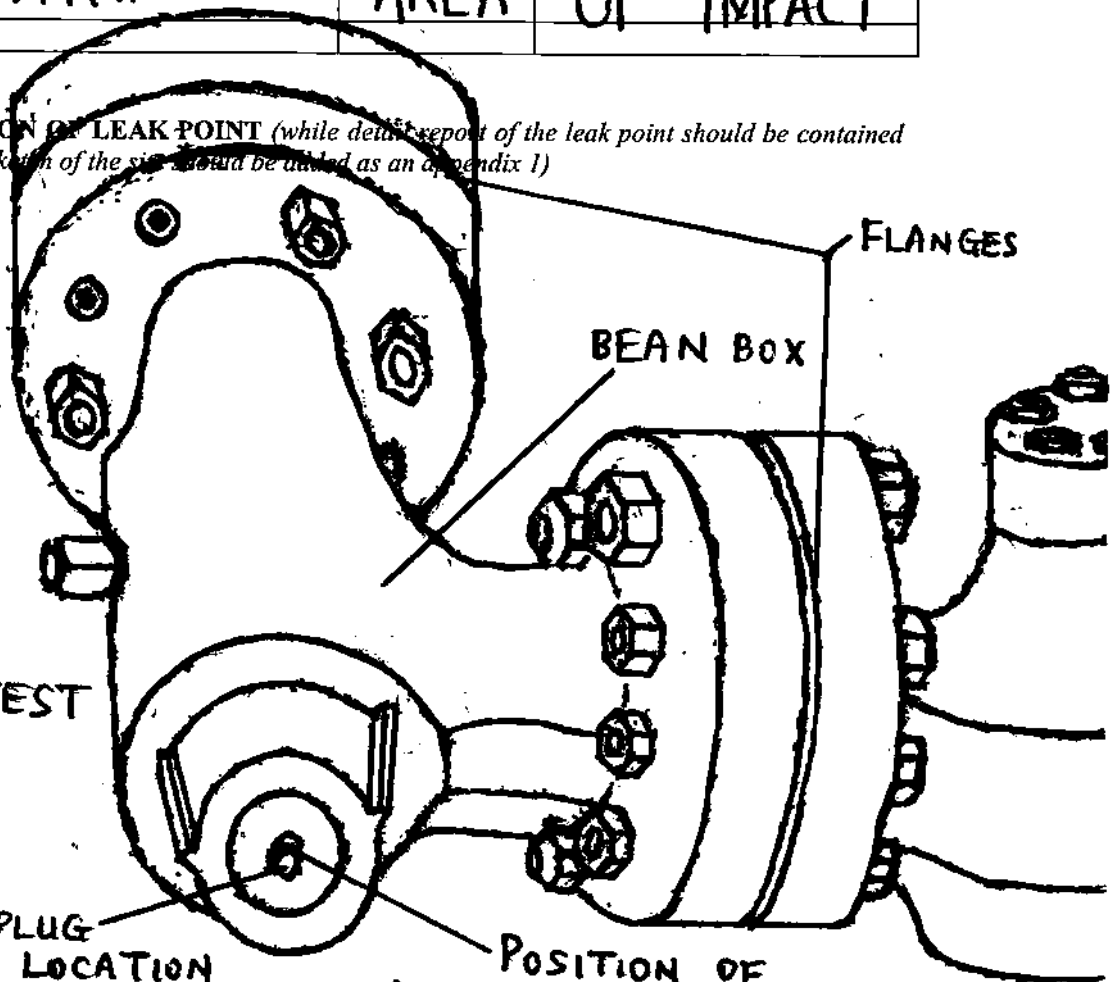

TEMPORARY PLUG
INSTALLED AT LOCATION
OF MISSING KEROTEST
F: TABLE SHOWING SOME OF COORDINATES
CALCULATION VALVE.

POSITION OF
MISSING KEROTEST VALVE
TAKEN DURING JIV FOR AREA
(REMOVED BY UNKNOWN PERSON)
IDENTIFIED AS LEAK POINT.

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1134131 JIV report S/N: 0404

Recovered oil V_{rec} :	<u>NIL</u>	Barrels
---------------------------	------------	---------

22. Computation of estimated residual volume on site

a. Computation of estimated volume of pool of free phase oil (on land or confined water body).

- i. Area (m^2) occupied by pool of free phase oil 1189
- ii. Average Depth (m) of pool of free phase oil 0.003
- iii. Emulsification factor: NIL

iv.

Estimated Volume of pool of free phase oil.	<u>22.44</u>	barrels
V_{pool} :		

b. Computation of estimated volume of infiltrated oil in the soil (V_{inf}).

1. Estimated Volume of infiltrated oil at spill point ($V_{inf a}$)

- i. Area* (m^2) of soil covered by the oil: NOT APPLICABLE
- ii. Average Depth (m) above leaking facility i.e. pipeline/flowline: NOT APPLICABLE
- iii. Soil type: THIRD PARTY INTERFERENCE iv. P_e (effective porosity of the soil): NOT APPLICABLE
- v. Cause of spill: THIRD PARTY INTERFERENCE vi. Oil type: BONNY MEDIUM
- vii. Oil Residence time on site, day: 3 DAYS
- viii. Average depth of infiltration below leaking facility i.e. pipeline/flowline: NOT APPLICABLE
- ix. Estimated depth of infiltration around spill point: NOT APPLICABLE

x.

Estimated Volume of infiltrated oil at spill point. $V_{inf a}$:	<u>NIL</u>	barrels
---	------------	---------

2. Estimated Volume of infiltrated oil at second spill point [if applicable] ($V_{inf b}$)

- i. Area* (m^2) of soil covered by the oil: NOT APPLICABLE
- ii. Average Depth (m) above leaking facility i.e. pipeline/flowline: NOT APPLICABLE
- iii. Soil type: NOT APPLICABLE iv. P_e (effective porosity of the soil): NOT APPLICABLE
- v. Cause of spill: NOT APPLICABLE vi. Oil type: NOT APPLICABLE
- vii. Oil Residence time on site, day: NOT APPLICABLE
- viii. Average depth of infiltration below leaking facility i.e. pipeline/flowline: NOT APPLICABLE
- ix. Estimated depth of infiltration around spill point: NOT APPLICABLE

Estimated Volume of infiltrated oil at spill point. $V_{inf b}$:	<u>NIL</u>	barrels
---	------------	---------

3. E

Estimated Volume of infiltrated oil outside immediate spill point(s) region ($V_{inf c}$)

- i. Area (m^2) of soil covered by the oil: 653
- ii. Area (m^2) of the pool of free phase oil in touch with soil: 145
- iii. Average Depth (m) below ground surface of infiltration of oil: 0.003
- iv. Soil type: SILT
- v. P_e (effective porosity of the soil): 21%

vi.

Estimated Volume of infiltrated oil. At $V_{inf c}$:	<u>2.89</u>	barrels
---	-------------	---------

23. Computation of estimated volume of oil on open water based on standard coloration.

- i. Total area of oil on open water: NIL

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1134131 JIV report S/N: 0404

ii. Table of average depth of oil on water based on coloration (

***Spill Factors from USCG FOG (2000 Edition)*

	Thickness (mm)	Percentage coverage	Volume (m3)
Barely Visible	0.00004	NOT APPLICABLE	
Silvery	0.00008		
Slight Color	0.00015		
Bright Color	0.0003		
Dull	0.001		
Dark	0.002		
Black oil	0.1		
Emulsion (30% Oil)	1		

iii.	Percent Total 100%	Estimated Volume of oil on open water. V_{wat} :	NIL	Barrels
------	--------------------	--	------------	---------

24. Calculation of evaporated volume:

i. Estimated Volume available for evaporation within surface area: **25.32 BARRELS**

ii. E-Factor: **15%**

iii.	Estimated Volume of evaporated oil. V_{evap} :	4.47	Barrels
------	--	-------------	---------

Evaporation Factors (E-Factor) for SPDC Crude oil			
Oil Type	Days on site	Bonny Light	Bonny Medium
Oil Residence time	< 1 day	10%	5%
	1-7 days	25%	15%
	> 7 days	40%	25%

25. Net Estimated Spilled Volume V_{res} (bbbls) = V_{evap} (bbbls) + V_{wat} (bbbls) + V_{inf} (bbbls) + V_{pool} (bbbls) + V_{rec} (bbbls) = **4.47 + NIL + 2.89 + 22.44 + NIL = 29.79**

Estimated Reported Volume V_{rep} (bbbls) = **30 BARRELS****

Calculation of the respective estimated volume is to be done on site as far as practicable using the new spill volume estimation software on site; Conversion of m^3 to barrels is Volume (m3) x 6.29; **Round up estimated volume to next whole number using the following rules:

- Any spill volume in excess of 1 bbl is rounded up to the next whole number.
- Any spill volume in less than 1 bbl is rounded up to the next 0.1 bbl.

Examples: Calculated volume = 15.3 bbl ----- Reported volume = 16 bbl
 Calculated volume = 0.35 bbl ----- Reported volume = 0.4 bbl
 Calculated volume = 0.01 bbl ----- Reported volume = 0.1 bbl.

Wherever this estimation tool is not applicable please refer to paragraph 6c (Deviations) of the JIV procedure to use appropriate steps for column estimation; record the calculation in a plain sheet of paper and attach to the JIV report.

26. GENERAL STATUS OF THE SITE

A. Joint investigation of the incident site found that there is no residual impact after the initial response and therefore recommend that the site be closed out

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1134131 JIV report S/N: 0404

B. Investigation of the incident site showed that there is residual impact on site requiring further works

27. REPRESENTATIVES

This report was filled, agreed and signed on the 06/03/2014 by joint investigation representatives from

- Host Community:
- Department of Petroleum Resources [DPR]:
- National Oil Spill Detection and Response Agency [NOSDRA]:
- State Ministry of Environment [SME]:
- Nigeria Police Force [NPF]:
- Shell Petroleum Development Company [SPDC]:
- Signatories agree with reported findings:
- Separate DPR form has been filled out with same findings

Tick as applicable

28. Appendix 1: Overview sketch of the site

Location: IMD RIVER 2 WELL 28L WELLHEAD AT UMVEDEKWARA (UDAGWA)

