

JOINT INVESTIGATION REPORT

INCIDENT NO: 2731466 JIV report S/N: 0551

(Note: As practicable as possible the JIT report is to be signed in the field by all the participating parties)

A. GENERAL INFORMATION:

1. Fountain Incident Number: 2731466 2. Type of incident* OIL SPILL
3. Name of Location UBIE FLOWSTATION SAVER PIT
4. Name of nearest community IDU- EKPEYE 5. State: RIVERS 6. LGA AHOADA-WEST
7. Production Facility/Installation FLOWSTATION
8. Asset Owner/Hub THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED (SPDC)/CENTRAL HUB

B. INCIDENT INFORMATION:

9. Details of incident
a. Date Reported: 12TH SEPTEMBER, 2020
b. Start date/time of Investigation: 17TH SEPTEMBER, 2020 / 1300HRS
c. Investigation End date: 22ND SEPTEMBER, 2020 Day(s) on site: TWO (2) DAYS
d. Description of spill point environment
 Firm soil Loose soil Recently excavated area
 Under water Swampy Exposed pipe surface
 Well Platform (on water) Drill Rig Sand bag(s)

Additional observations around the spill point: THE JOINT INVESTIGATION TEAM OBSERVED THE CONTAINMENT BOOMS WERE FOUND TO BE TAMPERED ON THE SECOND DAY OF INVESTIGATION BY UNKNOWN PERSONS.

- e. Description of leak point (tick as applicable);
 Smooth round-edge hole Rough-edge hole Hack saw cut
 Complete Rupture Inward dent, Well head tampering
 Failed Weld-on illegal hot tap valve Failed Clamp, Missing Pipeline/Flowline
 Crude oil theft (illegal bunkering) point, Saver-pit over flow Third party tampering with Clamp
 Third party tampering with valve setting Bulging Outward Third party tampering with flange,
 Flare System/Bund wall failure Cold vent Surge vessel overflow,
 Valve Failure Relief valve failure Accidental 3rd party equipment impact
 Tear (_____)
 Others (specify) _____
- f. Incident caused by:
 Third party interference (Sabotage ; crude theft ; Line theft ; Accidental 3rd party damage
 Operational Others (including Mystery spills) _____

*This can be: (a) Oil Spill (b) Drilling fluid/Chemical (c) Siltation (d) Water Leak (e) Fire (f) Non-leaking theft point removal

Version 2020/01

Distribution of copies: White (Asset Owner); Pink (DPR); Green (NOSDRA); Yellow (State Ministry of Environment); Blue (Host Community)

JOINT INVESTIGATION REPORT

INCIDENT NO: 2731466 JIV report S/N: 0551

g. Spill Point Coordinates (*Incidents $\leq 100m$ apart to be aggregated into one Joint Investigation Report)

h. Measuring unit

WGS 84

Northing: <u>LATITUDE</u>	Easting: <u>LONGITUDE</u>
<u>05.11074</u>	<u>006.55706</u>
 	
 	

C. RISK ASSESSMENT

10. Details of Environment

i. Type of environment where spill occurred (select one):

- Land
 Swamp
 Water
 Seasonal swamp
 Shoreline/Waterfront

ii. Type of environment to which oil has spread:

- Land
 Swamp
 Waterbody (specify) _____

iii. Weather condition

- Dry
 Wet
 Windy
 Hot

11. Distance to Sensitive habitat within 100m radius

- Government reserved and designated protected area [NIL ,m]
- Drinking water source [NIL ,m]
 - Surface water
 - Borehole
- Built up Area [NIL ,m]
 - Residential Area
 - Commercial/Industrial Area
- Farmlands [NIL ,m]
- Fish Farm/Pond [IMPACTED]
- Fishing net [NIL ,m]
- Others (specify) _____ [NIL ,m]

12. Containment measures put in place:

- Booms
 Trench
 Dyke
 Pit
 Natural depression
 None
- Others: _____

13. Any pictures or video coverage? [Y] [N]

14. Further response/repair initiated as at the time of JIV? [Y] [N]

If yes to item 14, give brief description:

NOT APPLICABLE

JOINT INVESTIGATION REPORT

INCIDENT NO: 2731466 JIV report S/N: 0551

15. Was there any disruption to the investigation? [Y] [N]

If yes to item 15 give brief description:

NOT APPLICABLE

16. Was JIV delayed? [Y] [N]

Reason(s):

- Delayed Community Access Approval
 Security Challenges
 Access constraint due to terrain
 Others (specify) COMMUNITY UNREST AT SHELL I.A PREVENTING JIV LOGISTICS

D. TYPE/NUMBERS OF PROPERTIES, IF ANY, FOUND WITHIN THE AREA OF SPREAD OF OIL

17. Structures / Properties

S/N	Type of Structures	Description	Size	Number	Comments
NONE WITHIN AREA OF IMPACT					

18. Crops/Economic Trees

S/N	Type of crops	Young	Medium	Matured	Quantity	Comments
1	RAFIA PALM	1ND	2NDS	2NDS	5NDS	IMPACTED

19. Fish/Nets/Ponds

S/N	Fish/Nets/Ponds	Description	Quantity/Size	Comments
1	PONDS	SMALL	2NDS	IMPACTED

20. Others (Specify) e.g. Animal Traps

S/N	Others	Description	Quantity/Size	Comments
NONE WITHIN AREA OF IMPACT				

E. GRAPHIC DESCRIPTION OF LEAK POINT (while detailed description of the leak point should be contained in the leak report, overview sketch of the site should be added as appendix 1) A SECTION OF UBIE FLOW STATION SAVER PIT AT IDU-EKPEYE SHOWING OVERFLOWN SAVER PIT.



JOINT INVESTIGATION REPORT

INCIDENT NO: 2731466 JIV report S/N: 0551

F: TABLE SHOWING SOME OF COORDINATES TAKEN DURING JIV FOR AREA CALCULATION

21. Impacted area boundary Coordinates (If more, Print and attach as Appendix)

S/N	Northing	Easting

SEE ATTACHED COPY
FOR COORDINATES LISTING

APPENDIX A

UBIE FLOWSTATION SAVER PIT AT IDU-EKPEYE

INCIDENT NO:2731466

WGS 84

POINT	LONGITUDE	LATITUDE
SPILL POINT	6.55706	5.11074
1	6.5564	5.11066
2	6.55644	5.11082
3	6.55625	5.11092
4	6.55616	5.11095
5	6.55608	5.11105
6	6.55602	5.11105
7	6.55594	5.11095
8	6.55589	5.11079
9	6.55592	5.11073
10	6.55591	5.1106
11	6.55592	5.11032
12	6.55634	5.11048
13	6.55642	5.11059
14	6.55641	5.11063
15	6.55644	5.11064
16	6.55643	5.11065
17	6.55648	5.11077
18	6.55652	5.11075
19	6.5565	5.1107
20	6.55648	5.11072
21	6.55702	5.11044
22	6.55703	5.11046
23	6.55701	5.11046
24	6.55709	5.11077
25	6.55705	5.11077
26	6.55702	5.11064
27	6.55706	5.11063

JOINT INVESTIGATION REPORT

INCIDENT NO: 2731466 JIV report S/N: 0551.

G. INCIDENT INFORMATION:

a. Impacted Area Details *

- Total calculated area of impact (Ha) 0.33Ha
- Impact within SPDC R.O.W YES
- Impact outside SPDC R.O.W YES

* Round off to 2 decimal places if area is $\geq 100 \text{ m}^2$ or to 4 decimal places if area is $< 100 \text{ m}^2$ (e.g. 14.55, 0.0051, 0.0009)

* Express in Hectares (Ha)

b. Volume of oil recovered before completion of JIV (V_{rec}):

Recovered oil V_{rec} :	<u>2</u>	Barrels
----------------------------------	----------	---------

Controlled recovery/evacuation from source with no impact to environment:

<u>NIL</u>	Barrels
------------	---------

c. Net Estimated Spilled Volume V_{Est} (bbls)* = 4.73 BARRELS

Estimated Reported Volume** V_{rep} (bbls) = 5 BARRELS

*Notes:

- Volume estimation was done using an excel based tool. (see attached for details on the calculation)
- Reported spilled volume is an estimate

Write other relevant notes taken into consideration for volume estimation or cause of spill:

Calculation of the respective estimated volume is to be done on site as far as practicable using the new spill volume estimation software on site; Conversion of m^3 to barrels is Volume (m^3) \times 6.29; **Round up estimated volume to next whole number using the following rules:

- Any spill volume in excess of 1 bbl is rounded up to the next whole number.
- Any spill volume in less than 1 bbl is rounded up to the next 0.1 bbl.

Examples: Calculated volume = 15.3 bbl ----- Reported volume = 16 bbl
Calculated volume = 0.35 bbl ----- Reported volume = 0.4 bbl
Calculated volume = 0.01 bbl ----- Reported volume = 0.1 bbl.

Wherever this estimation tool is not applicable please refer to paragraph 6c (Deviations) of the JIV procedure to use appropriate steps for column estimation; record the calculation in a plain sheet of paper and attach to the JIV report.

JOINT INVESTIGATION REPORT

INCIDENT NO: 2731466 JIV report S/N: 0551

d. General Status of the site

- i. Joint investigation of the incident site found that there is no residual impact after the initial response and JIT therefore recommend that the site be closed out
- ii. Investigation of the incident site showed that there is residual impact on site requiring further works

e. Representatives

This report was filled, agreed and signed by the following joint investigation team representatives:


- Host Community:
- Department of Petroleum Resources [DPR]:
- National Oil Spill Detection and Response Agency [NOSDRA]:
- State Ministry of Environment [SME]:
- The Shell Petroleum Development Company [SPDC]:
- *Separate DPR form, has been filled out with same findings*
- *Separate NOSDRA form has been filled out with same findings*
- *Separate SME form has been filled out with same findings*

Tick as applicable

JOINT INVESTIGATION REPORT

INCIDENT NO: 2731466 JIV report S/N 0551

f. Appendix 1: Overview sketch of the site

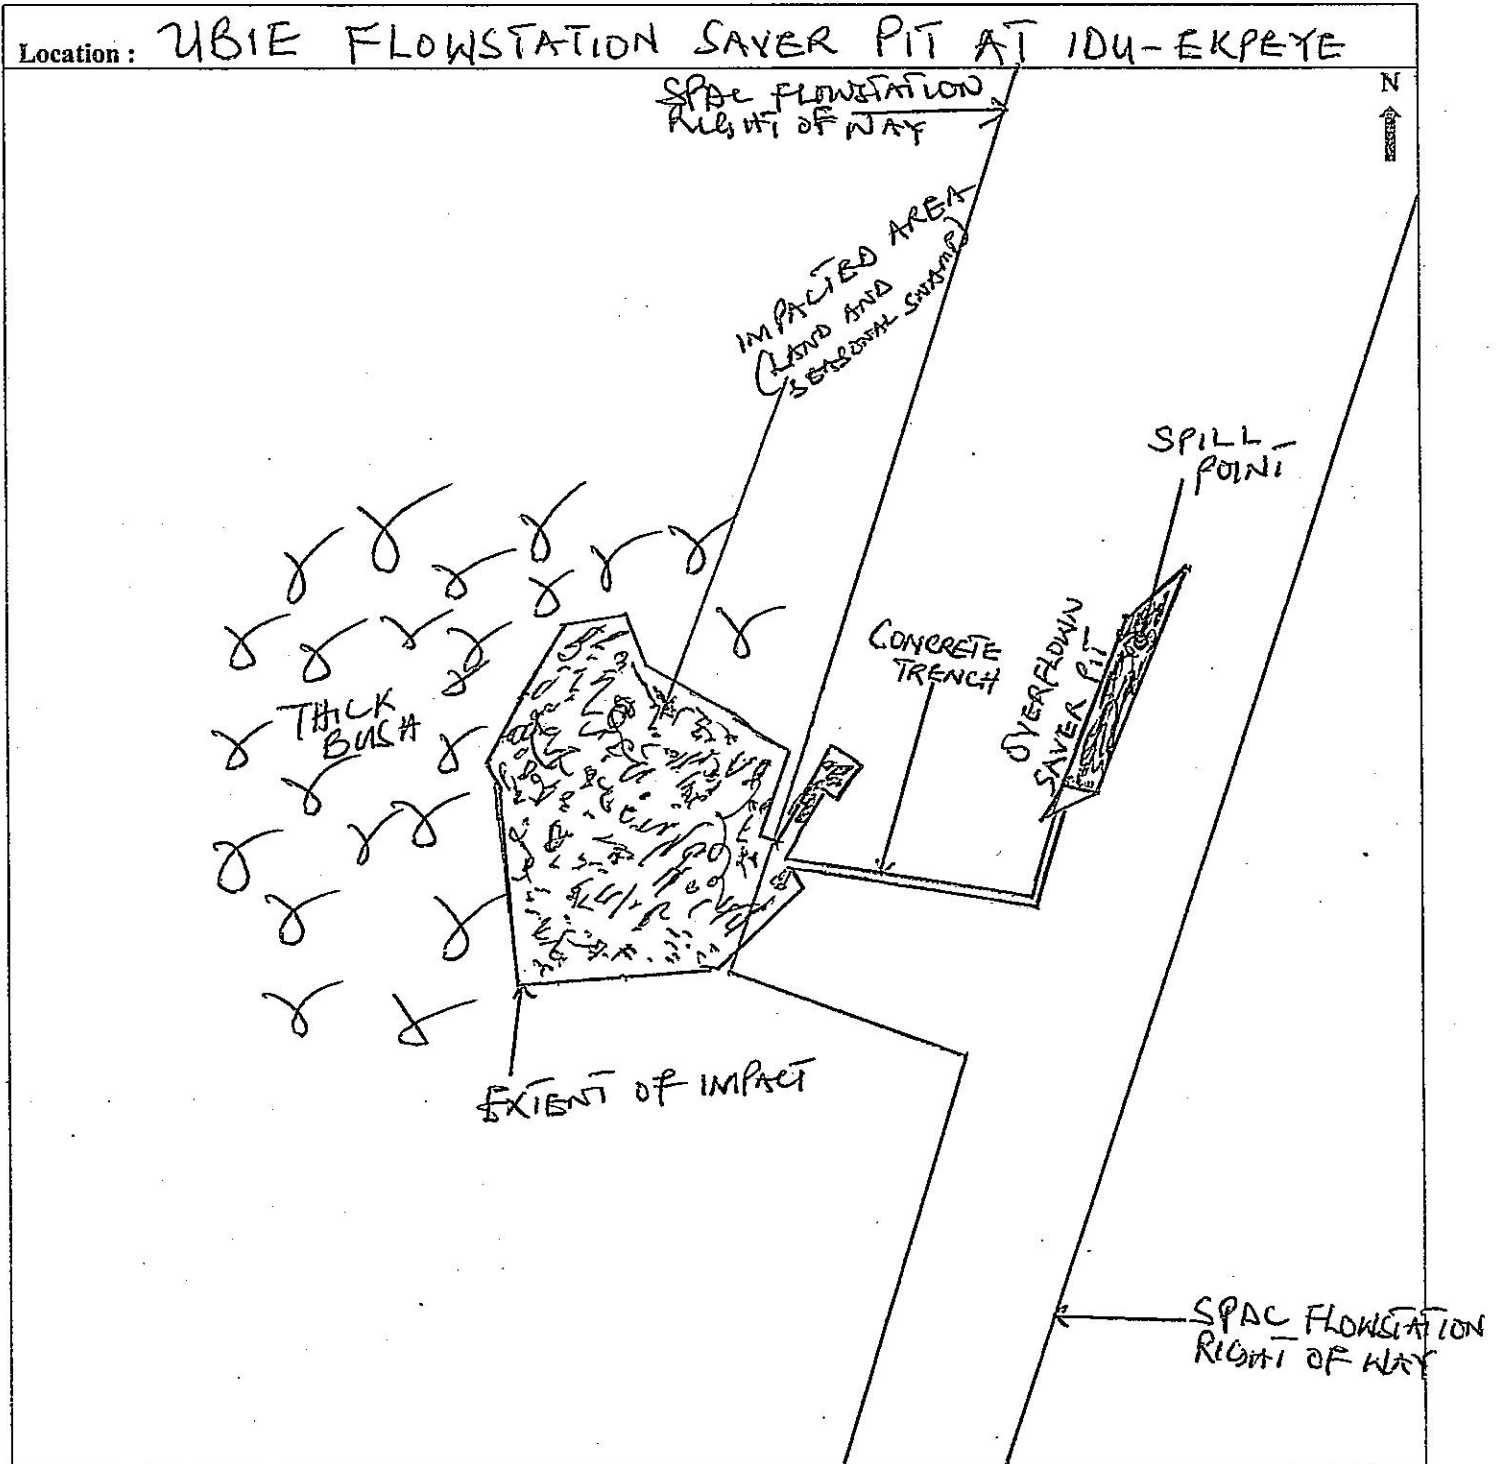

Version 2020/01