

# JOINT INVESTIGATION REPORT

INCIDENT NO: 2885750 JIV report S/N: 0000780

(Note: As practicable as possible the JIV report is to be signed in the field by all the participating parties)

## A. GENERAL INFORMATION:

1. Fountain Incident Number: 2885750 2. Type of incident\* OIL SPILL  
3. Name of Location 8" SIMIRI - IMOGATE PIPELINE  
4. Name of nearest community UMUELECHI 5. State: ABIA 6. LGA UKWA WEST  
7. Production Facility/Installation CRUDE OIL PIPELINE  
8. Asset Owner/Hub THE SHELL PETROLEUM DEVELOPMENT COMPANY  
OF NIGERIA LIMITED / PIPELINE

## B. INCIDENT INFORMATION:

9. Details of incident  
a. Date Reported: 11<sup>TH</sup> MARCH 2021  
b. Start date/time of Investigation: 13<sup>TH</sup> MARCH 2021 / 14:09HRS  
c. Investigation End date: 14<sup>TH</sup> MARCH 2021 Day(s) on site: TWO DAYS  
d. Description of spill point environment  
☐ Firm soil ☒ Loose soil ☐ Recently excavated area  
☐ Under water ☒ Swampy ☐ Exposed pipe surface  
☐ Well Platform (on water) ☐ Drill Rig ☐ Sand bag(s)

Additional observations around the spill point:

NOT APPLICABLE

## e. Description of leak point (tick as applicable);

- |   |  |  |
|---|--|--|
| <input type="checkbox"/> Smooth round-edge hole                             | <input type="checkbox"/> Rough-edge hole         | <input type="checkbox"/> Hack saw cut                                      |
| <input type="checkbox"/> Complete Rupture                                   | <input checked="" type="checkbox"/> Inward dent, | <input type="checkbox"/> Well head tampering                               |
| <input type="checkbox"/> Failed Weld-on illegal hot tap valve               | <input type="checkbox"/> Failed Clamp,           | <input type="checkbox"/> Missing Pipeline/Flowline                         |
| <input type="checkbox"/> Crude oil theft (illegal bunkering) point,         | <input type="checkbox"/> Saver-pit over flow     | <input type="checkbox"/> Third party tampering with Clamp                  |
| <input type="checkbox"/> Third party tampering with valve setting           | <input type="checkbox"/> Bulging Outward         | <input type="checkbox"/> Third party tampering with flange,                |
| <input type="checkbox"/> Flare System/Bund wall failure                     | <input type="checkbox"/> Cold vent               | <input type="checkbox"/> Surge vessel overflow,                            |
| <input type="checkbox"/> Valve Failure                                      | <input type="checkbox"/> Relief valve failure    | <input type="checkbox"/> Accidental 3 <sup>rd</sup> party equipment impact |
| <input type="checkbox"/> Tear (_____)                                       |  |  |
| <input checked="" type="checkbox"/> Others (specify) <u>SHARP EDGE HOLE</u> |  |  |

## f. Incident caused by:

- ☒ Third party interference (Sabotage ☒; crude theft ☐; Line theft ☐; Accidental 3<sup>rd</sup> party damage ☐  
☐ Operational ☐ Others (including Mystery spills) \_\_\_\_\_

\*This can be: (a) Oil Spill (b) Drilling fluid/Chemical (c) Siltation (d) Water Leak (e) Fire (f) Non-leaking theft point removal

Version 2020/01

Distribution of copies: White (Asset Owner); Pink (DPR); Green (NOSDRA); Yellow (State Ministry of Environment);  
Blue (Host Community)



# JOINT INVESTIGATION REPORT

0000780

INCIDENT NO: 2885750 JIV report S/N:

g. Spill Point Coordinates (\*Incidents  $\leq 100m$  apart to be aggregated into one Joint Investigation Report)

h. Measuring unit

WGS 84

Northing:	Easting:
4.87990	7.22256

## C. RISK ASSESSMENT

### 10. Details of Environment

i. Type of environment where spill occurred (select one):

☐ Land ☒ Swamp ☐ Water ☐ Seasonal swamp ☐ Shoreline/Waterfront

ii. Type of environment to which oil has spread:

☐ Land ☒ Swamp ☐ Waterbody (specify) \_\_\_\_\_

iii. Weather condition

☐ Dry ☒ Wet ☐ Windy ☐ Hot

### 11. Distance to Sensitive habitat within 100m radius

☐ Government reserved and designated protected area [ ,m]  
☐ Drinking water source [ ,m]  
☐ Surface water ☐ Borehole  
☐ Built up Area [ ,m]  
☐ Residential Area ☐ Commercial/Industrial Area  
☐ Farmlands [ ,m]  
☐ Fish Farm/Pond [ ,m]  
☐ Fishing net [ ,m]  
☐ Others (specify) \_\_\_\_\_ [ ,m]

NONE SEEN  
WITHIN VICINITY

### 12. Containment measures put in place:

☐ Booms ☐ Trench ☒ Dyke ☐ Pit ☒ Natural depression ☐ None

☐ Others: \_\_\_\_\_

13. Any pictures or video coverage?

☒ [N]

14. Further response/repair initiated as at the time of JIV?

☒ [N]

If yes to item 14, give brief description:

REPAIR WORK ONGOING.

Version 2020/01



# JOINT INVESTIGATION REPORT

INCIDENT NO: 2885750 JIV report S/N: 0000780

15. Was there any disruption to the investigation? [ Y ] [ ☒ ]

If yes to item 15 give brief description:

NOT APPLICABLE

16. Was JIV delayed? [ Y ] [ ☒ ]

Reason(s):

☐ Delayed Community Access Approval ☐ Security Challenges ☐ Access constraint due to terrain

☒ Others (specify) NOT APPLICABLE

D. TYPE/NUMBERS OF PROPERTIES, IF ANY, FOUND WITHIN THE AREA OF SPREAD OF OIL

17. Structures / Properties

S/N	Type of Structures	Description	Size	Number	Comments
<u>NONE WITHIN AREA OF IMPACT</u>					

18. Crops/Economic Trees

S/N	Type of crops	Young	Medium	Matured	Quantity	Comments
1	<u>PALM TREE</u>	<input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>	<u>FEW</u>	<u>IMPACTED BY SPILL</u>
2	<u>RAFIA PALM</u>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>	<u>FEW</u>	

19. Fish/Nets/Ponds


S/N	Fish/Nets/Ponds	Description	Quantity/Size	Comments
<u>NONE WITHIN AREA OF IMPACT</u>				

20. Others (Specify) e.g. Animal Traps

S/N	Others	Description	Quantity/Size	Comments
<u>NONE WITHIN AREA OF IMPACT</u>				

E. GRAPHIC DESCRIPTION OF LEAK POINT (while detailed description of the leak point should be contained in the leak report, overview sketch of the site should be added as appendix 1)

SECTION OF 8" ISIMIRI - IMOATE PIPELINE AT UMUELECHI  
SHOWING INWARD DENT AND SHARP EDGE HOLE BETWEEN  
10 O'CLOCK TO 11 O'CLOCK POSITION.

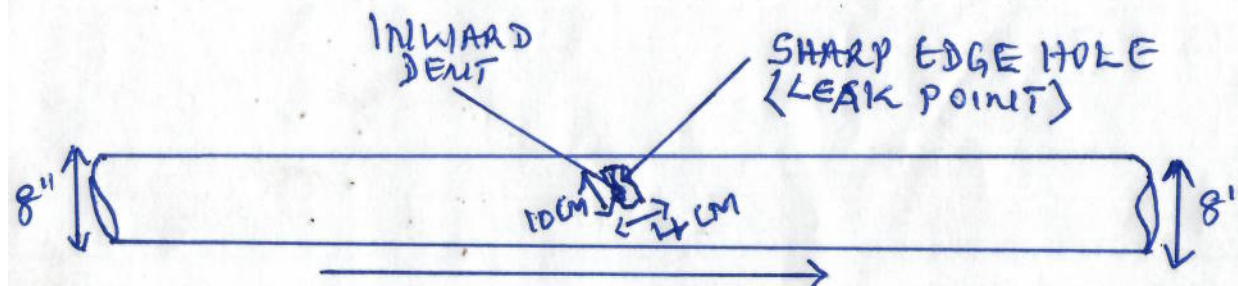

FROM ISIMIRI TO IMOATE



# JOINT INVESTIGATION REPORT

INCIDENT NO: 2885750 JIV report S/N: 0000780

**F: TABLE SHOWING SOME OF COORDINATES TAKEN DURING JIV FOR AREA CALCULATION**

21. Impacted area boundary Coordinates (If more, Print and attach as Appendix)

[illegible]

JIV ALONG ISIMIRI TO IMO GATE MANIFOLD DELIVERY LINE AT UMUELECHI

PNTID	LAT	LONG
242	4.87995	7.22237
243	4.87997	7.22242
244	4.88009	7.22245
245	4.88013	7.22252
246	4.88016	7.22263
247	4.88005	7.22282
248	4.87991	7.2227
249	4.87986	7.22271
250	4.87983	7.22287
251	4.87977	7.22321
252	4.87974	7.22324
253	4.87972	7.22321
254	4.87979	7.22287
255	4.87969	7.22283
256	4.87971	7.22245
257	4.87977	7.2222
258	4.87988	7.22193
259	4.87994	7.22182
260	4.87999	7.22179
261	4.88005	7.22171
262	4.88009	7.22173
263	4.88005	7.22183
264	4.88005	7.22188
265	4.88002	7.22208
266	4.87996	7.22232
267	4.87999	7.22233
268	4.87998	7.22236





# JOINT INVESTIGATION REPORT

INCIDENT NO: 2885750 JIV report S/N: 0000780

## G. INCIDENT INFORMATION:

### a. Impacted Area Details \*

- Total calculated area of impact (Ha) 0.36 HA
- Impact within SPDC R.O.W YES
- Impact outside SPDC R.O.W YES

\* Round off to 2 decimal places if area is  $\geq 100 \text{ m}^2$  or to 4 decimal places if area is  $< 100 \text{ m}^2$  (e.g. 14.55, 0.0051, 0.0009)

\* Express in Hectares (Ha)

### b. Volume of oil recovered before completion of JIV ( $V_{\text{recJ}}$ ):

Recovered oil $V_{\text{recJ}}$ :	<u>NIL</u>	Barrels
-----------------------------------	------------	---------

Controlled recovery/evacuation from source with no impact to environment:

<u>NIL</u>	Barrels
------------	---------

### c. Net Estimated Spilled Volume $V_{\text{Est}}(\text{bbls})^* =$

210.11 BARRELS

### Estimated Reported Volume\*\* $V_{\text{rep}}(\text{bbls}) =$

211 BARRELS

#### \*Notes:

- Volume estimation was done using an excel based tool. (see attached for details on the calculation)
- Reported spilled volume is an estimate

Write other relevant notes taken into consideration for volume estimation or cause of spill:

NOT APPLICABLE

Calculation of the respective estimated volume is to be done on site as far as practicable using the new spill volume estimation software on site; Conversion of  $\text{m}^3$  to barrels is Volume ( $\text{m}^3$ )  $\times 6.29$ ; \*\*Round up estimated volume to next whole number using the following rules:

- Any spill volume in excess of 1 bbl is rounded up to the next whole number.
- Any spill volume in less than 1 bbl is rounded up to the next 0.1 bbl.

Examples: Calculated volume = 15.3 bbl ----- Reported volume = 16 bbl  
Calculated volume = 0.35 bbl ----- Reported volume = 0.4 bbl  
Calculated volume = 0.01 bbl ----- Reported volume = 0.1 bbl.

Wherever this estimation tool is not applicable please refer to paragraph 6c (Deviations) of the JIV procedure to use appropriate steps for column estimation; record the calculation in a plain sheet of paper and attach to the JIV report.

# JOINT INVESTIGATION REPORT

INCIDENT NO: 2885750 JIV report S/N: 0000780

## d. General Status of the site

- |  |
|--|
| i. Joint investigation of the incident site found that there is no residual impact after the initial response and JIT therefore recommend that the site be closed out <input type="checkbox"/> |
| ii. Investigation of the incident site showed that there is residual impact on site requiring further works <input checked="" type="checkbox"/>  |

## e. Representatives

This report was filled, agreed and signed by the following joint investigation team representatives:

- Host Community: ☒
- Department of Petroleum Resources [DPR]: ☒
- National Oil Spill Detection and Response Agency [NOSDRA]: ☒
- State Ministry of Environment [SME]: ☒
- The Shell Petroleum Development Company [SPDC]: ☒
- Separate DPR form has been filled out with same findings ☒
- Separate NOSDRA form has been filled out with same findings ☒
- Separate SME form has been filled out with same findings ☒

*Tick as applicable*



# JOINT INVESTIGATION REPORT

INCIDENT NO: 2885750 JIV report S/N: 0000780

## f. Appendix 1: Overview sketch of the site

