

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 0537 914544

(Note: As practicable as possible the JIT report is to be signed in the field by all the participating parties)

A. GENERAL INFORMATION:

1. Spill incident Number: 914544 2. Type of incident * OIL SPILL
 3. Name of Location 24" BOMU - BONNY PIPELINE
 4. Name of nearest community MOGHO 5. State: RIVER 6. LGA GOKANJA
 7. Type of Production facility/Installation OIL PIPELINE 8. Asset owner/ District NPE / PH1

B. INCIDENT INFORMATION:

9. Details of incident

- a. Date of incident: 9TH JANUARY, 2013
 b. Start date/time of investigation: 10TH JANUARY, 2013 / 11:15 AM.
 c. Investigation End date: 10TH JANUARY, 2013.
 d. Description of spill point environment
 Firmed soil Loose soil Previously excavated area
 Under water Swampy Exposed pipe surface
 Well Platform (on Water) Rig
 e. Description of leak point (tick as applicable);
 Drilled hole Hack saw cut Explosive tear,
 Complete Rupture Inward dent, Well head tampering
 Failed Weld-on illegal hot tap valve, Missing Pipeline/Flowline)
 Crude oil theft (illegal) bunkering) point, Third party tampering with Clamp
 Third party tampering with valve setting, Third party tampering with flange,
 Corrosion Saver-pit over flow, Surge vessel overflow
 Outward dent Flare System/Bund wall failure
 Valve Failure com unit failure Cold vent
 Relief valve failure Others (specify) _____
 f. Incident caused by:
 Third party interference Operational Mystery _____

g. Spill point coordinates

Measuring unit (M)		<u>MINNA MID-BELT</u>	
Northing:		Easting:	
<u>71775.29</u>		<u>534974.93</u>	

*This can be a) Oil spill b) Drilling fluid/Chemical c) siltation d) construction e) Encroachment f) Fire,

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 0537 914544

C. RISK ASSESSMENT

10. Type of environment:

- Land Swamp Water Seasonal swamp

i. Type of environment to which oil has spread:

- Land Swamp Water River (identify) _____

ii. Weather condition

- Raining Sunny

11. Distance from the nearest sensitive habitat

- Government reserved and designated protected area [,m]
- Drinking water source [,m]
- Built up area [,m]
- Farmlands [,m]
- Fish Farm/Pond [,m]
- Fishing net [,m]
- Others (specify). [,m]

} NOT APPLICABLE.

12. Containment measures put in place;

- Booms Trench Dyke

Others: CONTAINMENT PIT

13. Any pictures or video coverage? [N]

14. Was there any disruption to the investigation? [Y]

If yes give brief description:

NOT APPLICABLE.

D. TYPE/NUMBERS OF PROPERTIES, IF ANY, FOUND WITHIN THE AREA OF SPREAD OF OIL

15. Structures / Properties

S/N	Type of Structures	Description	Size	Number	Comments
	<u>NONE WITHIN AREA OF IMPACT</u>				

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 0537 914544

16. Crops/Economic Trees

S/N	Type of crops	Young	Medium	Matured	Quantity	Comments
	NONE WITHIN AREA OF IMPACT					

17. Fish/Nets/Ponds


S/N	Fish/Nets/Ponds	Description	Quantity/Size	Comments
	NONE WITHIN AREA OF IMPACT			

18. Others (Specify) i.e. Animal Traps

S/N	Others	Description	Quantity/Size	Comments
	NONE WITHIN AREA OF IMPACT			

E. GRAPHIC DESCRIPTION OF LEAK POINT While detail report of the leak point should be contained in the Leak report, overview sketch of the site should be added as an appendix 1)

SECTION OF 24" BONNY - BONNY PIPELINE AT MUGHO
SHOWING POSITION OF HACK SAW CUT AT 10 O'CLOCK POSITION.

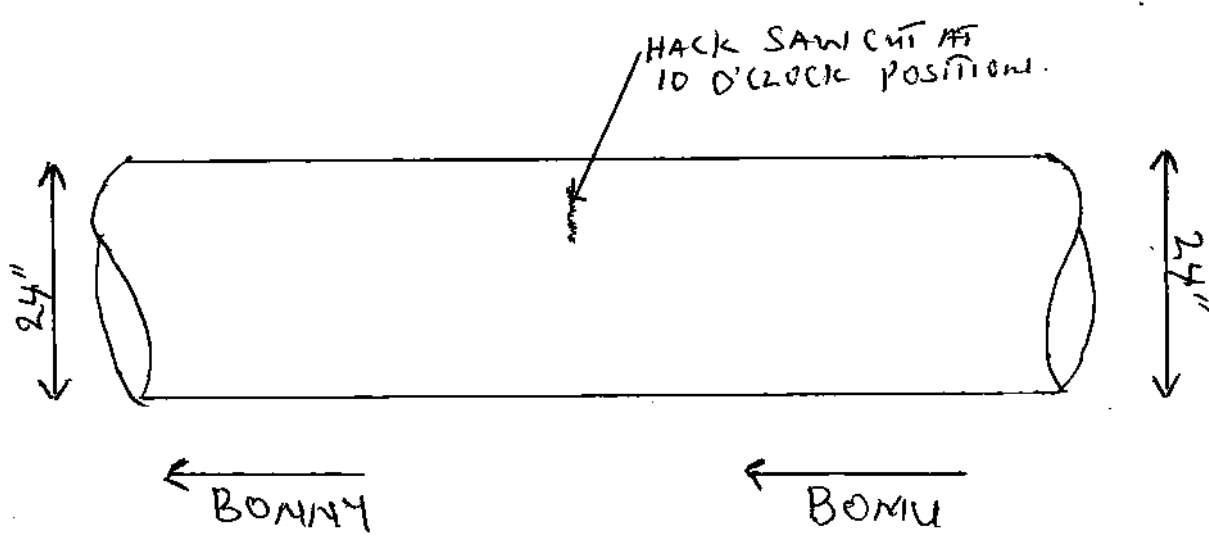

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 0537 914544

F: TABLE SHOWING SOME OF COORDINATES TAKEN DURING JIV FOR AREA CALCULATION

19. Impacted area boundary Coordinates (If more than 12 points, Attach as an appendix 2)

MINNA MID-BELT

S/N	Northing (m)	Easting (m)
WP55	71 781.43	534 974.94
WP56	71 769.15	534 971.84
WP57	71 781.43	534 974.94
WP58	71 790.68	534 959.54
WP59	71 796.83	534 953.39
WP60	71 806.06	534 944.16
WP61	71 827.56	534 947.28
WP62	71 839.81	534 968.88
WP63	71 809.88	534 974.99
WP64	71 769.14	534 978.00

G. INCIDENT INFORMATION:

20. Impacted Area Details

- Total calculated area of impact 0.14 Hci.
- Impact within SPDC R.O.W YES
- Impact outside R.O.W YES

21. Volume of oil recovered before completion of JIV (V_{rec}):

Recovered oil V_{rec}	barrels
<u>1</u>	

20. Computation of the residual volume on site

a. Computation of volume of pool of free phase oil (on land or confined water body).

- i. Area (m^2) occupied by pool of free phase oil 540
- ii. Average Depth (m) of pool of free phase oil 0.002

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED

JOINT INVESTIGATION REPORT FOR INCIDENT NO: _____

0537 0114544

iii. Emulsification factor: NIL

iv.

Volume of pool of free phase oil. V_{pool} :	6.79	barrels
--	------	---------

b. Computation of volume of infiltrated oil in the soil (V_{inf}).

COMPUTATION OF VOLUME OF INFILTRATED OIL AT SPILL POINTS
 AREA = 3m²
 AVERAGE DEPTH = 0.95m
 EFFECTIVE POROSITY OF THE SOIL TYPE = 0.21
 3 x 0.95 x 0.21 x 6.29 = 3.77 BARRELS

i. Area *(m²) covered by the oil: 1397
 ii. Area of the pool of free phase oil in touch with soil: —
 iii. Average Depth (m) below ground surface of infiltration of oil: 0.002
 Soil type: SILT
 P_e (effective porosity of the soil): 21%

INFILTRATED OIL - SIDE SPILL POINTS = 3.69 BARRELS

iv.

Volume of infiltrated oil. V_{inf}	3.77 + 3.69 = 7.46	barrels
--------------------------------------	--------------------	---------

21. Computation of volume of oil on open water based on standard coloration.

i. Total area of oil on open water: NIL
 ii. Table of average depth of oil on water based on coloration**

	Thickness (mm)	Percentage coverage	Volume (m ³)
Barely Visible	0.00004		
Silvery	0.00008		
Slight Color	0.00015	NOT APPLICABLE	
Bright Color	0.0003		
Dull	0.001		
Dark	0.002		
Black oil	0.1		
Emulsion (30% Oil)	1		
Percent Total		100%	Total Volume bbl

iii.

Volume of oil on open water. V_{wat} :	NIL	barrels
--	-----	---------

22. Calculation of evaporated volume:

i. Oil type: BONNY MEDIUM
 ii. E-Factor: 15%

iii.

Volume of evaporated oil. V_{evap} :	2.69	barrels
--	------	---------

Evaporation Factors (E-Factor) for SPDC Crude oil			
Oil Type	Days on site	Bonny Light	Bonny Medium
Period Since Oil Spill	< 1 day	10%	5%
	1-7 days	25%	15% ✓
	> 7 days	40%	25%

*If area is not same as the total area of impact, please indicate in the overview sketch
 ** Spill Factor from USCG FOG (2000 Edition)

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 0537 914544

23. Gross Total Estimated Spilled Volume

$$V_{Est}(bbls) = V_{evap}(bbls) + V_{wat}(bbls) + V_{inf}(bbls) + V_{pool}(bbls) + V_{recj}(bbls)$$

$$V_{Est}(bbls) = 2.69 + NIL + 7.46 + 6.79 + 1 = 17.94 \text{ BARRELS}$$

24. Net Total Estimated Spilled Volume

$$V_{Est}(bbls) = V_{evap}(bbls) + 0.6 * V_{wat}(bbls) + V_{inf}(bbls) + V_{pool}(bbls) + V_{recj}(bbls)$$

$$V_{Est}(bbls) = 2.69 + NIL + 7.46 + 6.79 + 1 = 17.94 \approx 18 \text{ BARRELS}$$

*Calculation of the respective estimated volume is to be done on site as far as practicable using the new spill volume estimation software on site

*Conversion of m3 to barrels is Total volume VT (m3) x 6.29

*Emulsification factor for spill on water to consider is 60% of volume of oil.

25. GENERAL STATUS OF THE SITE

- A. Joint investigation of the incident site found that there is no residual impact after the initial response and therefore recommend that the site be closed out
- B. Investigation of the incident site showed that there is residual impact on site requiring further works

26 REPRESENTATIVES

This report was filled and signed on the 10/01/2013 at incident site by joint investigation representatives from

- Host Community
- Department of Petroleum Resources [DPR]: *SEE ATTACHED DPR INVESTIGATION REPORT*
- National Oil Spill Detection and Response Agency [NOSDRA]:
- State Ministry of Environment [SME]:
- Nigeria Police Force [NPF]:
- Shell Petroleum Development Company [SPDC]:

Tick as applicable

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED

JOINT INVESTIGATION REPORT FOR INCIDENT NO. 0537 914544

27. Appendix 1: Overview sketch of the site

